

OWNER: EISELE FLUGDIENST GMBH
ADDRESS: GAT - GEBAEUDE - FLUGHAFEN
 STUTT GART
 STUTT GART 70629
PHONE: 49-711-9988770
FAX: 49-711-9988772

OPERATOR: EISELE FLUGDIENST GMBH
ADDRESS: GAT - GEBAEUDE - FLUGHAFEN
 STUTT GART
 STUTT GART 70629
PHONE: 49-711-9988770
FAX: 49-711-9988772

ANALYST: PASCAL GHANAME +33-1.55.93.47.76 (DIRECT)
EMAIL: PASCAL.GHANAME@CAMPSYSTEMS.EU +33 (0) 1.55.93.45.80 (OFFICE)
 WWW.CAMPSYSTEMS.COM

PLEASE RECORD CHANGES TO ADDRESS, LAST ACTUALS (IF ANY) AND FAX THIS SHEET BACK TO CAMP.

Filter Criteria: Task Type In: ('AD','ADP','SB','SBP'); Group by Profile or Bulletin: Profile Type; For: Airframe,Engine,APU Etc;

AIRCRAFT SERIAL/REGNO: 525B-0498/D-CHIP **MODEL:** 525B - CJ3+ **MANUFACTURER:** TEXTRON AVIATION INC.

DATES		LAST ACTUALS		CURRENT ACTUAL	
CERTIFICATION DATE:	21-SEP-2016	3013:38 A/C HRS	as of 23-DEC-2020	A/C HRS	as of ___/___/___
		2613 AFL	as of 23-DEC-2020	AFL	as of ___/___/___
		2122 ACH	as of 23-DEC-2020	ACH	as of ___/___/___

ENGINE NO. 1 SERIAL/PART: 216092/75000-200 **MODEL:** FJ44-3A LOANER **MANUFACTURER:** WILLIAMS INTERNATIONAL

INSTALLED ON 12-DEC-2020		LAST ACTUALS		CURRENT ACTUAL	
3063:12 ENG. HRS	2993:33 A/C HRS	3083:17 ENG. HRS	as of 23-DEC-2020	ENG. HRS	as of ___/___/___
2419 ENC		2433 ENC	as of 23-DEC-2020	ENC	as of ___/___/___

ENGINE NO. 2 SERIAL/PART: 216118/75000-200 **MODEL:** FJ44-3A LOANER **MANUFACTURER:** WILLIAMS INTERNATIONAL

INSTALLED ON 12-DEC-2020		LAST ACTUALS		CURRENT ACTUAL	
3072:18 ENG. HRS	2993:33 A/C HRS	3092:23 ENG. HRS	as of 23-DEC-2020	ENG. HRS	as of ___/___/___
2500 ENC		2514 ENC	as of 23-DEC-2020	ENC	as of ___/___/___

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
AIRFRAME - AD - 525B-0498/D-CHIP							
EASA 2019-0086 R01	FLIGHT CONTROLS – ACTIVE TECHNOLOGY LOAD ALLEVIATING SYSTEM – DEACTIVATION / MODIFICATION - AIRPLANE FLIGHT MANUAL SUPPLEMENT – AMENDMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
23-AUG-2019		MOS HRS/MSC - AFL ACH					
EASA 2019-0086 R01 PARA (1)	DEACTIVATE THE ATLAS AND MODIFY THE TACS TO RESTRICT THEIR MOVEMENT, AMEND THE APPLICABLE AFMS, AMEND ITEM 27-60-01 "ATLAS INOPERATIVE" OF THE MMEL SUPPLEMENT TO REMOVE THE 10 FLIGHT HOURS (FH) TIME LIMIT, INFORM ALL FLIGHT CREWS AND, THEREAFTER, OPERATE THE AEROPLANE ACCORDINGLY					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
23-AUG-2019		MOS HRS/MSC - AFL ACH					
EASA 2019-0086 R01 PARA (4)	MODIFY THE AEROPLANE IN ACCORDANCE WITH THE INSTRUCTIONS OF SECTION 7 OF THE MODIFICATION SB.					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
23-AUG-2019		MOS HRS/MSC - AFL ACH					
EASA 2019-0086 R01 PARA (5)	MODIFICATION OF AN AEROPLANE AS REQUIRED BY PARAGRAPH (4) OF THIS AD CONSTITUTES TERMINATING ACTION FOR THE DEACTIVATION, LIMITATIONS AND REPETITIVE PRE-FLIGHT INSPECTIONS AS REQUIRED BY THIS AD FOR THAT AEROPLANE.					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
23-AUG-2019		MOS HRS/MSC - AFL ACH					
FAA 2005-17-11	PREVENT INCORRECT INSTALLATION OF WIRES TO THE ENGINE FIRE EXTINGUISHER BOTTLES					MANDATORY	NOT APPLICABLE - AD2005-17-11: INSTALLATION OF ID SLEEVES ON ENGINE FIRE BOTTLES, DOES NOT APPLY DUE TO AIRCRAFT SERIAL NUMBER.
		MOS HRS/MSC - AFL		18-SEP-2016 7:30 5			
FAA 2007-23-16	INCORPORATE ELECTRICAL POWER RELAY CIRCUIT PROTECTION KIT PART NUMBER SB525B-24-02					MANDATORY	NOT APPLICABLE - AD2007-23-16: ELECTRICAL CIRCUIT POWER PROTECTION, DOES NOT APPLY DUE TO AIRCRAFT SERIAL NUMBER.
19-DEC-2007		MOS HRS/MSC - AFL		18-SEP-2016 7:30 5			
FAA 2008-03-10	INSPECT THE LOWER WING SKIN STRUCTURE, FORWARD WING SPAR, LOWER FUSELAGE SKIN, FAIRINGS, AND THE EXTERNAL FAIRING FRAMES FOR CORROSION; REPAIR ANY DAMAGE FOUND; APPLY A CORROSION INHIBITIVE SEALANT TO THE FUSELAGE FAIRINGS BEFORE REINSTALLING; AND DISABLE THE COCKPIT MOUNTED PILOT RELIEF TUBE					AIRWORTHINESS	NOT APPLICABLE - AD2008-03-10: FUSELAGE LOWER SKIN INSPECT, DOES NOT APPLY DUE TO AIRCRAFT SERIAL NUMBER.
		DAYS HRS/MSC - AFL		18-SEP-2016 7:30 5			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2014-18-01	NAVIGATION - ROCKWELL COLLINS, INC. MODE S TRANSPONDERS - INSPECTION / MODIFICATION					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
14-OCT-2014		MOS HRS/MSC - AFL		22-SEP-2016			
FAA 2018-19-15	EQUIPMENT / FURNISHINGS - SAFETY BELT ATTACHMENT BOLTS - INSPECTION / TORQUE VERIFICATION / MODIFICATION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
14-NOV-2018		MOS HRS/MSC - AFL ACH					
FAA 2019-08-13	FLIGHT CONTROLS - MODELS 525, 525A, AND 525B AIRPLANES WITH TAMARACK ACTIVE LOAD ALLEVIATION SYSTEM (ATLAS) WINGLETS INSTALLED IN ACCORDANCE WITH SUPPLEMENTAL TYPE CERTIFICATE (STC) SA03842NY - REVISE THE OPERATING LIMITATIONS SECTION OF THE AIRPLANE FLIGHT MANUAL (AFM) TO PROHIBIT FURTHER FLIGHT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
24-MAY-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-12-09	NAVIGATION - FDSA-6500 TCAS - AFM OR AFMS LIMITATIONS SECTION - REVISION / PLACARD INSTALLATION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
23-JUL-2019		DAYS HRS/MSC - AFL ACH					
FAA 2019-14-05	EQUIPMENT / FURNISHING - SEAT ENERGY ABSORBER ASSEMBLY - REPLACEMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
03-SEP-2019		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
APPLIANCE - 525B-0498/D-CHIP							
EASA 2016-0167 R01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - REAR CABIN ATTENDANT SEAT - INSPECTION / REPAIR					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
02-FEB-2018		MOS HRS/MSC - AFL ACH					
EASA 2016-0167 R01 (CORR)	APPLIANCE AD - EQUIPMENT / FURNISHINGS - REAR CABIN ATTENDANT SEAT - INSPECTION / REPAIR					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 13 JUN 2018 // WO CHIP-11/18
02-FEB-2018		MOS HRS/MSC - AFL ACH					
EASA 2016-0167 R01 PARA (1)	REMOVE SEAT FROM THE AEROPLANE AND ACCOMPLISH A DETAILED VISUAL INSPECTION (DVI)					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
02-FEB-2018		MOS HRS/MSC - AFL ACH					
EASA 2016-0167 R01 PARA (2)	DETAILED VISUAL INSPECTION (DVI)					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
02-FEB-2018		MOS HRS/MSC - AFL ACH					
EASA 2016-0167 R01 PARA (3)	ACCOMPLISH THE APPLICABLE TEMPORARY CORRECTIVE ACTIONS (IF, DURING ANY INSPECTION AS REQUIRED BY PARAS (1) OR (2) OF THIS AD, AS APPLICABLE, CORROSION OR OTHER DAMAGE IS FOUND)					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
02-FEB-2018		MOS HRS/MSC - AFL ACH					
EASA 2016-0167 R01 PARA (4)	TEMPORARILY STOWING AND SECURING A DAMAGED ATTENDANT SEAT IN RETRACTED POSITION TO PREVENT OCCUPANCY, IN ACCORDANCE WITH THE PROVISIONS AND LIMITATIONS OF THE APPLICABLE MASTER MINIMUM EQUIPMENT LIST ITEM, IS AN ACCEPTABLE ALTERNATIVE METHOD TO DEFER COMPLIANCE WITH THE REQUIREMENTS OF PARA (3) OF THIS AD.					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
02-FEB-2018		MOS HRS/MSC - AFL ACH					
EASA 2016-0167 R01 PARA (5)	IT IS ALLOWED TO INSTALL (SEE NOTE 2 OF THIS AD) ON ANY AEROPLANE AN AFFECTED SEAT, HAVING ACCUMULATED MORE THAN 14 MONTHS SINCE FIRST INSTALLATION ON AN AEROPLANE, PROVIDED THAT, BEFORE (RE)INSTALLATION, IT HAS PASSED AN INSPECTION IN ACCORDANCE WITH THE INSTRUCTIONS OF SECTION 2, SUBPART B, OF ZODIAC SEATS FRANCE SB NO. 536-25-002					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
02-FEB-2018		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2016-0167 R01 PARA (6)	MODIFICATION AND RE-IDENTIFICATION (P/N CHANGE) OF A SEAT IN ACCORDANCE WITH THE INSTRUCTIONS OF ZODIAC SEATS FRANCE SB NO. 536-25-004 CONSTITUTE TERMINATING ACTION FOR THE REPETITIVE INSPECTIONS AS REQUIRED BY PARAS (1) AND (2) OF THIS AD FOR THAT SEAT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
02-FEB-2018		MOS HRS/MSC - AFL ACH					
EASA 2016-0210	APPLIANCE AD - EQUIPMENT / FURNISHINGS - SEAT ENERGY ABSORBER ASSEMBLY - REPLACEMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
EASA 2016-0256	APPLIANCE AD - EQUIPMENT / FURNISHINGS - PILOT AND CO-PILOT SEATS - MODIFICATION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
EASA 2016-0256 PARA (1)	MODIFY AND RE-IDENTIFY EACH AFFECTED SEAT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
EASA 2016-0256 PARA (2)	DO NOT INSTALL AN AFFECTED SEAT ON ANY AEROPLANE					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
EASA 2017-0001	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CABIN ATTENDANT SEAT - INSPECTION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
EASA 2017-0192	APPLIANCE AD - EQUIPMENT AND FURNISHING - PASSENGER SEATS - MODIFICATION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
EASA 2017-0225	APPLIANCE AD - EQUIPMENT / FURNISHINGS - SEAT RESTRAINT SYSTEMS - AFM AMENDMENT / MODIFICATION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
01-DEC-2017		MOS HRS/MSC - AFL ACH					
EASA 2017-0225 PARA (1)	INSTALL A PLACARD AS SPECIFIED IN TABLE 1 OF THIS AD IN FULL VIEW OF THE PILOT(S), AMEND THE APPLICABLE AFM, INFORM ALL FLIGHT CREWS AND, THEREAFTER, OPERATE THE AIRCRAFT ACCORDINGLY					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
01-DEC-2017		DAYS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2017-0225 PARA (3)	DO NOT INSTALL AN AFFECTED PART ON ANY AIRCRAFT THAT, ACCORDING TO THE APPLICABLE AFM, IS CERTIFICATED IN THE AEROBATIC CATEGORY, AS REQUIRED BY PARAGRAPH (3.1) OR (3.2) OF THIS AD, AS APPLICABLE					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
01-DEC-2017		MOS HRS/MSC - AFL ACH					
EASA 2018-0195	APPLIANCE AD - EQUIPMENT / FURNISHINGS - RESTRAINT SYSTEMS ROTARY BUCKLE SUB ASSEMBLY - REMOVAL FROM SERVICE					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
18-SEP-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0223	APPLIANCE AD - EQUIPMENT / FURNISHING - SEAT ENERGY ABSORBER ASSEMBLY - MODIFICATION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
31-OCT-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0247	APPLIANCE AD - NAVIGATION - TRANSPONDERS - INSPECTION / MODIFICATION					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
27-NOV-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0247 PARA (1)	INSPECT THE INSTALLATION OF THE AFFECTED PART ON THE AIRCRAFT					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
27-NOV-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0247 PARA (2)	IF, DURING THE INSPECTION AS REQUIRED BY PARAGRAPH (1) OF THIS AD, IT IS DETERMINED THAT THE INSTALLATION IS NOT A CONVENTIONAL INSTALLATION, AS DEFINED IN THIS AD, BEFORE NEXT FLIGHT, REMOVE THE TRANSPONDER FROM SERVICE FOR IN-SHOP MODIFICATION.					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
27-NOV-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0247 PARA (3)	RETURNING AN AFFECTED PART, REMOVED FROM AN AIRCRAFT AS REQUIRED BY PARAGRAPH (2) OF THIS AD, TO TRIG AVIONICS FOR MODIFICATION, AND RE-INSTALLATION OF THAT MODIFIED TRANSPONDER ON THAT AIRCRAFT IS AN ACCEPTABLE METHOD TO COMPLY WITH THE REQUIREMENTS OF THIS AD FOR THAT AIRCRAFT					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
27-NOV-2018		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2018-0247 PARA (4)	FROM THE EFFECTIVE DATE OF THIS AD, DO NOT INSTALL AN AFFECTED PART ON ANY AIRCRAFT, UNLESS THE INSTALLATION IS CONVENTIONAL, AS DEFINED IN THIS AD					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
27-NOV-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0259	APPLIANCE AD - INFORMATION SYSTEMS - ELECTRONIC FLIGHT BAG UNIVERSAL SERIAL BUS RECEPTACLE - MODIFICATION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
14-DEC-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0259 PARA (1)	MODIFY EACH AFFECTED PART IN ACCORDANCE WITH THE INSTRUCTIONS OF THE APPLICABLE SB/EB					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
14-DEC-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0259 PARA (2)	AFTER MODIFICATION OF AN AEROPLANE AS REQUIRED BY PARAGRAPH (1) OF THIS AD, DO NOT INSTALL AN AFFECTED PART ON THAT AEROPLANE.					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
14-DEC-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0262	APPLIANCE AD - EQUIPMENT / FURNISHINGS - PILOT AND CO-PILOTS SEATS - MODIFICATION / INSPECTION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 27 DEC 2018 // WO CHIP-24/18 REV 01
20-DEC-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0262 PARA (1)	MODIFY AND RE-IDENTIFY EACH PRE-MOD SEAT (FOR GROUP 1 AEROPLANES) (RESTATEMENT OF EASA AD 2016-0256 (1))					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 27 DEC 2018 // WO CHIP-24/18 REV 01
20-DEC-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0262 PARA (2)	DO NOT INSTALL A PRE-MOD SEAT ON ANY AEROPLANE (RESTATEMENT OF EASA AD 2016-0256 PARA (2))					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 27 DEC 2018 // WO CHIP-24/18 REV 01
20-DEC-2018		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2018-0262 PARA (3)	INSPECT ANY AFFECTED SPRING OF EACH SEAT; REPLACE BOTH SPRINGS (IF, DURING ANY INSPECTION ANY DAMAGE OR INCORRECT INSTALLATION OF AN EFFECTED SPING IS FOUND)					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 27 DEC 2018 // WO CHIP-24/18 REV 01
20-DEC-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0262 PARA (5)	IT IS ALLOWED TO DEFER ACCOMPLISHMENT OF CORRECTIVE ACTIONS REQUIRED BT PARA (4) OF THIS AD FOR THAT SEAT, PROVIDED A COPY OF THE ATR OEB IS INCLUDED IN THE APPLICABLE AFM, PILOTS ARE INFORMED, AND THE AEROPLANE IS OPERATED IAW THE INSTRUCTIONS OF THAT OEB (IF, DURING ANY INSPECTION AS REQ BY PARA (3) OF THIS AD, ANY DAMAGE OR INCORRECT INSTALLATION OF ONLY ONE AFFECTED SPRING IS FOUND ON THE PILOT OR CO-PILOT SEAT) (FOR ATR AEROPLANES)					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 27 DEC 2018 // WO CHIP-24/18 REV 01
20-DEC-2018		MOS HRS/MSC - AFL					
EASA 2018-0262 PARA (8)	IT IS ALLOWED TO INSTALL AN AFFECTED SPRING ON A SEAT INSTALLED ON AN AEROPLANE PROVIDED THAT, AFTER INSTALLATION, THAT SPRING PASSES AN INSPECTION (NO DEFECT FOUND)					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 27 DEC 2018 // WO CHIP-24/18 REV 01
20-DEC-2018		MOS HRS/MSC - AFL					
EASA 2018-0262 PARA (9) & (10)	REPORTING					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 27 DEC 2018 // WO CHIP-24/18 REV 01
20-DEC-2018		MOS HRS/MSC - AFL					
EASA 2018-0264	APPLIANCE AD - EQUIPMENT / FURNISHINGS - LIFE VEST POUCH - INSPECTION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 27 DEC 2018 // WO CHIP-24/18 REV 01
21-DEC-2018		MOS HRS/MSC - AFL ACH					
EASA 2018-0264 R01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - LIFE VEST POUCH - INSPECTION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
04-APR-2019		MOS HRS/MSC - AFL ACH					
EASA 2019-0004	APPLIANCE AD - NAVIGATION - GLOBAL NAVIGATION SATELLITE SYSTEM - OPERATIONAL LIMITATIONS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
25-JAN-2019		DAYS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2019-0010	APPLIANCE AD - EQUIPMENT/FURNINSHING - LIFE JACKET - REMOVAL/REPAIR					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
06-FEB-2019		MOS					
		HRS/MSC -					
		AFL					
		ACH					
EASA 2019-0010 PARA (1)	REMOVE EACH AFFECTED PART FROM SERVICE AND REPLACE IT WITH A SERVICEABLE PART					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
06-FEB-2019		MOS					
		HRS/MSC -					
		AFL					
		ACH					
EASA 2019-0010 PARA (2)	DO NOT INSTALL AN AFFECTED PART ON ANY AIRCRAFT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
06-FEB-2019		MOS					
		HRS/MSC -					
		AFL					
		ACH					
EASA 2019-0010 PARA (3)	DO NOT RELEASE TO SERVICE ANY AFFECTED PART, UNLESS IT HAS BEEN REPAIRED AND RE-IDENTIFIED					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
06-FEB-2019		MOS					
		HRS/MSC -					
		AFL					
		ACH					
EASA 2019-0086-E	APPLIANCE/EMERGENCY AD - FLIGHT CONTROLS - ACTIVE TECHNOLOGY LOAD ALLEVIATING SYSTEM - DEACTIVATION / MODIFICATION - AIRPLANE FLIGHT MANUAL SUPPLEMENT - AMENDMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
19-APR-2019		MOS					
		HRS/MSC -					
		AFL					
		ACH					
EASA 2019-0086-E PARA (1)	DEACTIVATE THE ATLAS AND MODIFY THE TACS TO RESTRICT THEIR MOVEMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
19-APR-2019		MOS					
		HRS/MSC -					
		AFL					
		ACH					
EASA 2019-0086-E PARA (4)	CONTACT CRANFIELD AEROSPACE SOLUTIONS FOR APPROVED ATLAS MODIFICATION INSTRUCTIONS AND ACCOMPLISH THOSE INSTRUCTIONS ACCORDINGLY					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
19-APR-2019		MOS					
		HRS/MSC -					
		AFL					
		ACH					
EASA 2019-0086-E PARA (5)	MODIFICATION OF AN AEROPLANE AS REQUIRED BY PARAGRAPH (4) OF THIS AD CONSTITUTES TERMINATING ACTION FOR THE DEACTIVATION, LIMITATIONS AND REPETITIVE PRE-FLIGHT INSPECTIONS AS REQUIRED BY THIS AD FOR THAT AEROPLANE					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
19-APR-2019		MOS					
		HRS/MSC -					
		AFL					
		ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2019-0179	APPLIANCE AD - NAVIGATION - AIRBORNE COLLISION AVOIDANCE SYSTEM DISPLAY SOFTWARE - UPDATE (SUPERSEDED BY EASA AD 2019-0179 R01)					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
31-JUL-2019		MOS HRS/MSC - AFL ACH					
EASA 2019-0179 PARA (1)	AMEND THE APPLICABLE AFM(S) IN ACCORDANCE WITH THE OPSB AND INSTALL THE APPROPRIATE PLACARD; VERIFY THAT A PRESSURE ALTITUDE REPORTING TRANSPONDER IS INSTALLED AND INTRODUCE PRE-FLIGHT CHECKS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
31-JUL-2019		DAYS HRS/MSC - AFL ACH					
EASA 2019-0179 PARA (2)	MODIFY THE AEROPLANE BY INSTALLING A SOFTWARE UPDATE THAT RECTIFIES THE UNSAFE CONDITION ADDRESSED BY THIS AD; BEFORE NEXT FLIGHT AFTER MODIFICATION REMOVE THE AFM CHANGES AND PLACARD AND CONCURRENT WITH REMOVAL OF THE AFM(S) CHANGE AND PLACARD INSERT THE APPLICABLE POST-SB MTB 34-02 AFM TC					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
31-JUL-2019		MOS HRS/MSC - AFL ACH					
EASA 2019-0179 R01	APPLIANCE AD - NAVIGATION - AIRBORNE COLLISION AVOIDANCE SYSTEM DISPLAY SOFTWARE - UPDATE					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 06 MAY 2020 // WO CHIP-04/20
24-APR-2020		MOS HRS/MSC - AFL ACH					
EASA 2019-0179 R01 PARA (1)	AMEND THE APPLICABLE AFM(S) IAW THE OPSB AND INSTALL THE APPROPRIATE PLACARD; VERIFY THAT A PRESSURE ALTITUDE REPORTING TRANSPONDER IS INSTALLED; AND INTRODUCE PRE-FLIGHT CHECKS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 06 MAY 2020 // WO CHIP-04/20
24-APR-2020		DAYS HRS/MSC AFL ACH					
EASA 2019-0179 R01 PARA (2) & (4)	MODIFY THE AEROPLANE BY INSTALLING A SOFTWARE UPDATE THAT RECTIFIES THE UNSAFE CONDITION THEN REMOVE THE AFM(S) CHANGES AND PLACARD, AS REQUIRED BY PARA (1) OF THIS AD. CONCURRENTLY, FOR CERTAIN TEXTRON AVIATION AEROPLANES, INSERT THE APPLICABLE POST-SB MTB-34-02 AFM TC OR POST-MOD AFMS, AS IDENTIFIED IN APPENDIX 2 OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 06 MAY 2020 // WO CHIP-04/20
24-APR-2020		MOS HRS/MSC AFL ACH					
FAA 1998-25-02	APPLIANCE AD - BFGOODRICH SKYWATCH SKY497					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
		MOS HRS/MSC - AFL		22-SEP-2016			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2015-23-09	APPLIANCE AD - OXYGEN - ZODIAC AEROTECHNICS (FORMERLY INTERTECHNIQUE AIRCRAFT SYSTEMS) FLIGHT CREW OXYGEN MASK REGULATORS - INSPECTION / REPLACEMENT OF OXYGEN MASK REGULATORS					MANDATORY	NOT APPLICABLE - N/A, SUSPECT PARTS NOT INSTALLED ON THIS AIRCRAFT..
28-DEC-2015		MOS HRS/MSC - AFL		18-SEP-2016 7:30 5			
FAA 2017-04-06	APPLIANCE AD - CABIN SYSTEMS - REPLACEMENT OF UNITED INSTRUMENTS INC. 5934 SERIES ALTIMETERS MANUFACTURED BETWEEN JANUARY 2015 AND FEBRUARY 2016					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
07-APR-2017		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
FAA 2017-06-03	APPLIANCE AD - HEATING SYSTEM - ACCOMPLISH REPETATIVE DETAILED INSPECTIONS AND PRESSURE DECAY TESTS OF THE COMBUSTION HEATER AND DISABLE / REMOVE IF NECESSARY					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
FAA 2017-06-03 PARA (G)	PERFORM INSPECTIONS AND PRESSURE DECAY TEST (PDT) OF THE COMBUSTION HEATER					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
FAA 2017-06-03 PARA (K)	DISABLE OR REMOVE COMBUSTION HEATER					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
FAA 2017-09-09	APPLIANCE AD - PASSENGER COMPARTMENT EQUIPMENT - REPLACEMENT OF ZODIAC SEATS CALIFORNIA LLC SEATING SYSTEMS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED
		MOS HRS/MSC - AFL		23-AUG-2018 1507:45 1303			
FAA 2017-16-01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - AMERI-KING CORPORATION MODEL AK-450() AND AK-451() SERIES EMERGENCY LOCATOR TRANSMITTERS - REPETATIVE INSPECTIONS, CHECKS, TESTS AND VERIFICATIONS					MANDATORY	NOT APPLICABLE
24-OCT-2017		MOS HRS/MSC - AFL ACH		23-NOV-2017 993:22 853 406			
FAA 2017-16-01 PARA (G)	PERFORM GENERAL VISUAL INSPECTIONS OF THE ELT FOR DISCREPANCIES; CHECKS , TESTS AND VERIFICATIONS AS APPLICABLE, TO ENSURE THE ELT IS FUNCTIONING, AND ALL APPLICABLE CORRECTIVE ACTIONS					MANDATORY	NOT APPLICABLE
24-OCT-2017		MOS HRS/MSC - AFL ACH		23-NOV-2017 993:22 853 406			
FAA 2017-16-01 PARA (J)	OPTIONAL TERMINATING ACTION: REPLACE ELT WITH A SERVICEABLE FAA-APPROVED ELT					MANDATORY	NOT APPLICABLE
24-OCT-2017		MOS HRS/MSC - AFL ACH		23-NOV-2017 993:22 853 406			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2017-18-12	APPLIANCE AD - OXYGEN - INSPECTION AND REPLACEMENT OF B/E AEROSPACE PROTECTIVE BREATHING EQUIPMENT (PBE), PART NUMBER 119003-11 AND 119003-21 THAT ARE INSTALLED ON AIRPLANES					MANDATORY	NOT APPLICABLE
16-OCT-2017		MOS		23-NOV-2017			
		HRS/MSC -		993:22			
		AFL		853			
		ACH		406			
FAA 2017-18-12 PARA (G)	INSPECTION RETAINED FROM AD 2016-11-20 FOR AIRPLANES WITH PBE, P/N 119003-11, INSTALLED					MANDATORY	NOT APPLICABLE
16-OCT-2017		MOS		23-NOV-2017			
		HRS/MSC -		993:22			
		AFL		853			
		ACH		406			
FAA 2017-18-12 PARA (H)	REPLACEMENT RETAINED FROM AD 2016-11-20 FOR AIRPLANES WITH PBE, P/N 119003-11, INSTALLED					MANDATORY	NOT APPLICABLE
16-OCT-2017		MOS		23-NOV-2017			
		HRS/MSC -		993:22			
		AFL		853			
		ACH		406			
FAA 2017-18-12 PARA (I) & (J)	INSPECT TO DETERMINE IF THE S/N OF THE INSTALLED PBE, P/N 119003-21, IS WITHIN THE RANGE OF 004-14768M THROUGH 004-21093M OR 004-02393M THROUGH 004-03033M AND IF FOUND WITHIN THE S/N RANGE REPLACE IT.					MANDATORY	NOT APPLICABLE
16-OCT-2017		MOS		23-NOV-2017			
		HRS/MSC -		993:22			
		AFL		853			
		ACH		406			
FAA 2017-22-14	APPLIANCE AD - NAVIGATION - INSTALLATION OF THE TSSA-4100 FLS UPGRADES ON THE ROCKWELL COLLINS, INC. TSS-4100 TRAFFIC SURVEILLANCE SYSTEM PROCESSING UNITS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
20-DEC-2017		MOS					
		HRS/MSC -					
		AFL					
		ACH					
FAA 2018-03-04	APPLIANCE AD - NAVIGATION - REPLACEMENT OF ROSEMOUNT AEROSPACE INC. MODEL 851AK PITOT PROBES REPAIRED BY CSI AEROSPACE INC					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
16-MAR-2018		MOS					
		HRS/MSC -					
		AFL					
		ACH					
FAA 2018-03-04 PARA (G)	DETERMINE NUMBER OF AFFECTED PITOT PROBES INSTALLED					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
16-MAR-2018		DAYS					
		HRS/MSC -					
		AFL					
		ACH					
FAA 2018-03-04 PARA (H)(1)	REPLACE AFFECTED PITOT PROBES					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
16-MAR-2018		MOS					
		HRS/MSC -					
		AFL					
		ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2018-03-04 PARA (H)(2)	DO NOT INSTALL ON ANY AIRPLANE A PITOT PROBE HAVING A SERIAL NUMBER LISTED IN PARA (C)(1) OF THIS AD, UNLESS IT HAS BEEN PROPERLY REPAIRED, AND IF REPAIRED BY CSI AEROSPACE, INC., HAS A REPAIR DATE OF AUGUST 1, 2014, OR LATER					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 09 MAR 2018 // WO CHIP-02/18
16-MAR-2018		MOS HRS/MSC - AFL ACH					
FAA 2018-16-01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - SEAT ENERGY ABSORBER ASSEMBLY - REPLACEMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 23 AUG 2018 // WO CHIP-19/18
31-AUG-2018		MOS HRS/MSC - AFL ACH					
FAA 2018-16-01 PARA (G)	REVIEW EACH AFFECTED ATTENDANT SEAT NG AND PILOT SEAT 120/335, REMOVE AND REPLACE THE EA ASSEMBLIES ON EACH AFFECTED PILOT SEAT, AND REMOVE EACH AFFECTED ATTENDANT SEAT AND REPLACE WITH A REWORKED SEAT IN ACCORDANCE WITH B/E AEROSPACE FISCHER ASB NO. SB 9911-001, ISSUE B, DATED NOVEMBER 4, 2016					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 23 AUG 2018 // WO CHIP-19/18
31-AUG-2018		DAYS HRS/MSC - AFL ACH					
FAA 2018-16-01 PARA (H)	DO NOT INSTALL AN AFFECTED SEAT ON AN AIRCRAFT UNLESS, PRIOR TO INSTALLATION, THE EA ASSEMBLIES ON THE SEAT HAVE BEEN REPLACED IN ACCORDANCE WITH B/E AEROSPACE FISCHER ASB NO. SB 9911-001, ISSUE B, DATED NOVEMBER 4, 2016					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 23 AUG 2018 // WO CHIP-19/18
31-AUG-2018		MOS HRS/MSC - AFL ACH					
FAA 2018-16-13	APPLIANCE AD - EQUIPMENT/FURNISHINGS - INSPECT THE SAFETY BELT WEBBING, AND MODIFY AND RE-MARKING EACH AFFECTED CABIN ATTENDANT SEAT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
26-OCT-2018		MOS HRS/MSC - AFL ACH					
FAA 2018-16-13 PARA (G)	INSPECT SAFETY BELT WEBBING, MODIFY AND RE-MARK EACH AFFECTED CABIN ATTENDANT SEAT USING ZODIAC SEATS FRANCE SERVICE INFORMATION LETTER 537-01					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
26-OCT-2018		MOS HRS/MSC - AFL ACH					
FAA 2018-16-13 PARA (H)	DO NOT INSTALL ANY AFFECTED ZODIAC SEATS FRANCE CABIN ATTENDANT SEAT ON ANY AIRCRAFT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
26-OCT-2018		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2018-21-14	APPLIANCE AD - OXYGEN - OXYGEN MASK REGULATOR HARNESS INFLATION HOSES - INSPECTION / REPLACEMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
27-MAR-2019		MOS HRS/MSC - AFL ACH					
FAA 2018-21-14 PARA (G)	REQUIRED ACTIONS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
27-MAR-2019		MOS HRS/MSC - AFL ACH					
FAA 2018-21-14 PARA (H)	DO NOT INSTALL ON ANY AIRPLANE A FLIGHT CREW OXYGEN MASK REGULATOR WITH A P/N LISTED IN PLANNING INFORMATION, PARAGRAPH 1.A.(1), OF ZODIAC SB MC10-35-274 R02, DATED JUNE 25, 2014, UNLESS IT MEETS THE DEFINITION OF A PART ELIGIBLE FOR INSTALLATION IN PARA (I) OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
27-MAR-2019		MOS HRS/MSC - AFL ACH					
FAA 2018-23-01	APPLIANCE AD - EQUIPMENT / FURNISHINGS - CABIN ATTENDANT SEAT - INSPECTION AND REPLACEMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
28-DEC-2018		MOS HRS/MSC - AFL ACH					
FAA 2018-23-01 PARA (G)	INSPECT THE SEAT PAN STRUCTURE IN BOTH DEPLOYED AND STOWED POSITIONS (IF CRACKS ARE FOUND, REPLACE WITH REINFORCED SEAT PAN P/N F0511530 AND REMARK THE SEAT) (IF NO CRACKS ARE FOUND, REMARK THE SEAT AND REINSPECT OR REPLACE THE SEAT PAN WITH REINFORCED SEAT PAN P/N F0511530)					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
28-DEC-2018		MOS HRS/MSC - AFL ACH					
FAA 2018-23-01 PARA (H)	INSTALLATION OF A REINFORCED SEAT PAN, P/N F0511530, USING PARAGRAPH 2.B., ACCOMPLISHMENT INSTRUCTIONS, OF ZODIAC SEATS FRANCE SB NO. 536-25-003, REV. 3, DATED JUNE 2, 2017, IS TERMINATING ACTION TO THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
28-DEC-2018		MOS HRS/MSC - AFL ACH					
FAA 2018-23-12	APPLIANCE AD - EQUIPMENT / FURNISHINGS - INSPECTION AND REPLACEMENT OF ZODIAC AERO (ALSO KNOWN AS AIR CRUISERS COMPANY) EVACUATION SYSTEMS FUSIBLE PLUGS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
28-DEC-2018		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2018-23-12 PARA (G)	ACCOMPLISH AN INSPECTION TO DETERMINE IF ANY PLUG HAS PART NUMBER (P/N) B13984-3, STAMPED WITH LOT PA-21 OR PA-22					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
28-DEC-2018		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
FAA 2018-23-12 PARA (H)	REPLACE FUSIBLE PLUG WITH A SERVICEABLE FUSIBLE PLUG P/N B13984-3 THAT IS NOT STAMPED WITH LOT PA-21 OR PA-22					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
28-DEC-2018		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
FAA 2018-23-12 PARA (I)	NO PERSON SHAL INSTALL ON ANY AIRPLANE ANY FUSIBLE PLUG HAVING P/N B13984-3, STAMPED WITH LOT PA-21 OR PA-22					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 30 NOV 2018 // WO CHIP-24/18
28-DEC-2018		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
FAA 2019-01-02	APPLIANCE AD - NAVIGATION - AUTOMATIC DEPENDENT SURVEILLANCE-BROADCAST (ADS-B) IN - AIRPLANE FLIGHT MANUAL SUPPLEMENT (AFMS) - DISABLE / REVISE					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
07-FEB-2019		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
FAA 2019-01-02 PARA (G)(1)	DISABLE THE AUTOMATIC DEPENDENT SURVEILLANCE-BROADCAST (ADS-B) IN FUNCTION IN EACH UNIT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
07-FEB-2019		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
FAA 2019-01-02 PARA (G)(2)	REVISE THE AIRPLANE FLIGHT MANUAL SUPPLEMENT IN ACCORDANCE WITH PARAGRAPH 5.2.C OF SB2018-01					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
07-FEB-2019		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
FAA 2019-07-03	APPLIANCE AD - EQUIPMENT / FURNISHINGS - REAR CABIN ATTENDANT SEAT - INSPECTION / REPAIR					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
16-MAY-2019		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
FAA 2019-07-03 PARA (G)	REMOVE THE SEAT FROM THE AIRCRAFT AND PERFORM A DETAILED VISUAL INSPECTION; IF CORROSION OR OTHER DAMAGE IS FOUND, BEFORE NEXT FLIGHT OR BEFORE (RE)INSTALLATION OF THE SEAT ON AN AIRCRAFT, AS APPLICABLE, REPAIR THE SEAT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
16-MAY-2019		MOS					
		HRS/MSC	-				
		AFL					
		ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2019-07-03 PARA (H)	DO NOT INSTALL ON ANY AIRCRAFT AN AFFECTED ZODIAC SEATS FRANCE 536-SERIES CABIN ATTENDANT SEAT THAT HAS ACCUMULATED MORE THAN 14 MONTHS SINCE FIRST INSTALLATION ON ANY AIRCRAFT, UNLESS IT HAS PASSED AN INSPECTION IAW THE ACCOMPLISHMENT INSTRUCTIONS, PARAGRAPH 2.B., OF ZODIAC SEATS FRANCE SB NO. 536-25-002, REVISION 3, DATED NOVEMBER 2, 2016					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
16-MAY-2019		MOS		HRS/MSC -			
		AFL		ACH			
FAA 2019-07-03 PARA (I)	MODIFICATION AND RE-IDENTIFICATION (P/N CHANGE) OF A SEAT IN ACCORDANCE WITH THE ACCOMPLISHMENT INSTRUCTIONS, PARAGRAPH 2.A., OF ZODIAC SEATS FRANCE SB NO. 536-25-004, REV. 0, DATED OCTOBER 19, 2017, CONSTITUTES A TERMINATING ACTION FOR THE REPETITIVE INSPECTIONS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
16-MAY-2019		MOS		HRS/MSC -			
		AFL		ACH			
FAA 2019-07-10	APPLIANCE AD - NAVIGATION - LITEF ATTITUDE HEADING AND REFERENCE SYSTEM (AHRs) - REMOVAL					MANDATORY	NOT APPLICABLE - PN NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
29-MAY-2019		MOS		HRS/MSC -			
		AFL		ACH			
FAA 2019-07-10 PARA (F)(1)	REMOVE THE AHRs UNIT FROM SERVICE					MANDATORY	NOT APPLICABLE - PN NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
29-MAY-2019		MOS		HRS/MSC -			
		AFL		ACH			
FAA 2019-07-10 PARA (F)(2)	REMOVAL FROM SERVICE OF P/N 145130-7100 TERMINATES THE REQUIREMENTS OF AD 2010-26-09 (75 FR 81424, DECEMBER 28, 2010)					MANDATORY	NOT APPLICABLE - PN NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
29-MAY-2019		MOS		HRS/MSC -			
		AFL		ACH			
FAA 2019-07-10 PARA (F)(3)	DO NOT INSTALL AN AHRs UNIT P/N 145130-2000, 145130-2001, 145130-7000, 145130-7001, OR 145130-7100 ON ANY AIRCRAFT					MANDATORY	NOT APPLICABLE - PN NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
29-MAY-2019		MOS		HRS/MSC -			
		AFL		ACH			
FAA 2019-08-01	APPLIANCE AD - EQUIPEMENT AND FURNISHINGS - MODIFICATION AND RE-IDENTIFICATION OF ALL AFFECTED RECARO AIRCRAFT SEATING GMBH & CO. KG MODEL PASSENGER SEATS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
21-MAY-2019		MOS		HRS/MSC -			
		AFL		ACH			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2019-08-01 PARA (G)	MODIFY THE AFFECTED PASSENGER SEAT AND RE-IDENTIFY EACH MODIFIED PASSENGER SEAT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
21-MAY-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-08-01 PARA (H)	AFTER THE EFFECTIVE DATE OF THIS AD, DO NOT INSTALL AN AFFECTED RECARO MODEL PASSENGER SEAT ON ANY AIRCRAFT, UNLESS THE SEAT HAS BEEN MODIFIED AND RE-IDENTIFIED IN ACCORDANCE WITH PARAGRAPH (G)(2), (3), OR (4) OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
21-MAY-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-13-03	APPLIANCE AD - TRIG AVIONICS LTD. - NAVIGATION - TRANSPONDERS INSTALLATION - INSPECTION / MODIFICATION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
27-AUG-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-13-03 PARA (G)	INSPECT THE TRANSPONDER INSTALLATION TO DETERMINE IF THE TRANSPONDER IS INSTALLED IN A CONVENTIONAL AFT-FACING AVIONICS RACK					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
27-AUG-2019		DAYS HRS/MSC - AFL ACH					
FAA 2019-13-03 PARA (H)	DO NOT INSTALL AN AFFECTED TRANSPONDER ON ANY AIRCRAFT, UNLESS THE TRANSPONDER IS INSTALLED IN A CONVENTIONAL AFT-FACING AVIONICS RACK AS DEFINED IN THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
27-AUG-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-14-05 PARA (G)	REVIEW EACH AFFECTED B/E AEROSPACE FISCHER COMMON SEAT TO DETERMINE IF REWORK HAS ALREADY BEEN PERFORMED. IF THE REWORK HAS NOT BEEN PERFORMED REWORK THE AFFECTED SEATS AND MARK THE SEAT BY INSTALLING A PLACARD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
03-SEP-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-14-05 PARA (H)	DO NOT INSTALL ANY SEAT AFFECTED BY THIS AD ONTO ANY AIRCRAFT UNLESS THE SEAT IS MARKED WITH A PLACARD STATING COMPLETION OF B/E AEROSPACE FISCHER ASB NO. SB0718-004, ISSUE A, DATED JUNE 26, 2018					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
03-SEP-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-15-10	APPLIANCE AD - EQUIPMENT / FURNISHING - LIFE JACKET - REMOVAL / REPAIR					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 13 SEP 2019 // WO CHIP-21/19
19-SEP-2019		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2019-15-10 PARA (G)	REMOVE EACH AFFECTED LIFE JACKET FROM THE AIRPLANE AND REPLACE THE LIFE JACKET WITH A LIFE JACKET ELIGIBLE FOR INSTALLATION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 13 SEP 2019 // WO CHIP-21/19
19-SEP-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-15-10 PARA (H)	DO NOT INSTALL ON ANY AIRPLANE AN AFFECTED LIFE JACKET UNLESS IT HAS BEEN REPAIRED AND MARKED TO INDICATE COMPLIANCE WITH SUCH REPAIR IN ACCORDANCE WITH ZODIAC AEROSPACE SERVICES SB 25-65-34, REVISION 01, DATED MARCH 15, 2019, OR ORIGINAL ISSUE, DATED JANUARY 8, 2019; OR A METHOD APPROVED BY THE FAA					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 13 SEP 2019 // WO CHIP-21/19
19-SEP-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-21-06	APPLIANCE AD - FLIGHT COMPARTMENT EQUIPMENT - IPECO HOLDINGS LTD. -MODIFICATION AND REIDENTIFICATION OF PILOT'S AND CO-PILOT'S SEATS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 24 JAN 2020 // WO CHIP-01/20
13-DEC-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-21-06 PARA (G)(1)	MODIFY AND RE-IDENTIFY EACH AFFECTED PILOT AND CO-PILOT SEAT (RESTATEMENT OF FAA 2017-22-02)					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 24 JAN 2020 // WO CHIP-01/20
13-DEC-2019		MOS HRS/MSC AFL ACH					
FAA 2019-21-06 PARA (G)(2)	INSPECT ANY AFFECTED SPRING OF EACH SEAT; REPLACE BOTH SPRINGS (IF, DURING ANY INSPECTION ANY DAMAGE OR INCORRECT INSTALLATION OF AN EFFECTED SPING IS FOUND)					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 24 JAN 2020 // WO CHIP-01/20
13-DEC-2019		MOS HRS/MSC AFL ACH					
FAA 2019-21-06 PARA (G)(3)	SEND THE INSPECTION RESULTS, INCLUDING NO FINDINGS, TO IPECO AT TECHNICALSUPPORT@IPECO.COM					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 24 JAN 2020 // WO CHIP-01/20
13-DEC-2019		DAYS HRS/MSC AFL ACH					
FAA 2019-21-06 PARA (H)	DO NOT INSTALL ANY PILOT OR CO-PILOT SEAT IDENTIFIED IN PARAGRAPH (C)(1)(I) OF THIS AD UNLESS THE SEAT IS MODIFIED AND RE-IDENTIFIED AS SPECIFIED IN PARAGRAPH (G)(1) OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 24 JAN 2020 // WO CHIP-01/20
13-DEC-2019		MOS HRS/MSC - AFL ACH					
FAA 2019-21-09	APPLIANCE AD - EQUIPMENT / FURNISHINGS - LIFE VEST POUCH - INSPECTION / REPLACEMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 24 JAN 2020 // WO CHIP-01/20
18-DEC-2019		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2019-21-09 PARA (G)	INSPECT THE AFFECTED SEAT LIFE VEST POUCH ASSEMBLY; IF, DURING THE INSPECTION A LIFE VEST POUCH VELCRO STRIP IS FOUND DAMAGED OR WORN OR A LIFE VEST POUCH INSTALLATION IS NOT FOUND ACCEPTABLE, BEFORE FURTHER FLIGHT, REMOVE THE LIFE VEST POUCH FROM SERVICE AND REPLACE IT WITH A PART ELIGIBLE FOR INSTALLATION					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 24 JAN 2020 // WO CHIP-01/20
18-DEC-2019		MOS HRS/MSC AFL ACH					
FAA 2019-21-09 PARA (I)	AFTER THE EFFECTIVE DATE OF THIS AD, DO NOT INSTALL AN AVIOINTERIORS CENTAURUS ECONOMY CLASS PASSENGER SEAT WITH A P/N IDENTIFIED IN PARAGRAPH (C) OF THIS AD UNLESS THE AFFECTED SEAT LIFE VEST POUCH ASSEMBLY HAS BEEN INSPECTED IN ACCORDANCE WITH PARAGRAPH (G)(1) OF THIS AD					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 24 JAN 2020 // WO CHIP-01/20
18-DEC-2019		MOS HRS/MSC - AFL ACH					
FAA 2020-08-02	APPLIANCE AD - NAVIGATION - THALES AVS FRANCE SAS - GLOBAL NAVIGATION SATELLITE SYSTEM - OPERATIONAL LIMITATIONS					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 06 MAY 2020 // WO CHIP-04/20
19-MAY-2020		MOS HRS/MSC - AFL ACH					
FAA 2020-09-02	APPLIANCE AD - EQUIPMENT/FURNISHINGS - ANJOU AERONAUTIQUE - RESTRAINT SYSTEMS ROTARY BUCKLE SUB ASSEMBLY - REPLACEMENT					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 06 MAY 2020 // WO CHIP-04/20
29-MAY-2020		MOS HRS/MSC - AFL ACH					
FAA 2020-09-02 PARA (G)(1)	INSPECT EACH RESTRAINT SYSTEM FOR PROPER RELEASE OF THE STRAPS FROM THE RESTRAINT SYSTEM AND, DEPENDING IF THE STRAPS RELEASE, PLACARD THE SEAT AS INOPERATIVE AND REMOVE AND REPLACE THE ROTARY BUCKLE SUB-ASSEMBLY (FOR THE RESTRAINT SYSTEMS LISTED IN THE EFFECTIVITY OF ANJOU AERO SB 358SB-14-101 R01, EXCEPT FOR S/NS 1038-1048 (INCLUSIVE), 1050-1055 (INCLUSIVE), AND 1062-1073 (INCLUSIVE))					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 06 MAY 2020 // WO CHIP-04/20
29-MAY-2020		MOS HRS/MSC AFL ACH					
FAA 2020-09-02 PARA (G)(2)	INSPECT EACH RESTRAINT SYSTEM FOR PROPER RELEASE OF THE STRAPS FROM THE RESTRAINT SYSTEM AND, DEPENDING IF THE STRAPS RELEASE, PLACARD THE SEAT AS INOPERATIVE AND REMOVE AND REPLACE THE RESTRAINT SYSTEM FROM SERVICE (FOR RESTRAINT SYSTEMS, P/N 358XX-XXX-YY-ZZZ (WHERE 358XX-XXX-YY-ZZZ CAN BE ANY COMBINATION OF NUMBERS AND/OR LETTERS), HAVING S/NS 738-1619 (INCLUSIVE))					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 06 MAY 2020 // WO CHIP-04/20
29-MAY-2020		MOS HRS/MSC AFL ACH					
FAA 2020-09-02 PARA (H)	DO NOT INSTALL ON ANY AIRCRAFT AN ANJOU AERONAUTIQUE RESTRAINT SYSTEM, P/N 358XX-XXX-YY-ZZZ, HAVING S/NS 738-1619 (INCLUSIVE), EVEN IF THE RESTRAINT SYSTEM IS LABELED IN COMPLIANCE WITH ANJOU AERO SB 358SB-14-101 R01, DATED DECEMBER 12, 2014					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 06 MAY 2020 // WO CHIP-04/20
29-MAY-2020		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
FAA 2020-10-05	APPLIANCE AD - NAVIGATION - ROCKWELL COLLINS PRO LINE 4 AND PRO LINE 21 FLIGHT MANAGEMENT SYSTEMS					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 06 AUG 2020 // WO CHIP-08/20
24-JUN-2020		MOS HRS/MSC AFL ACH					
FAA 2020-16-08	APPLIANCE AD - ASPEN AVIONICS, INC. - EFD1000 FLIGHT DISPLAY SYSTEMS - AIRPLANE FLIGHT MANUAL - REVISION					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 07 SEP 2020 // CHIP-11/20
17-AUG-2020		MOS HRS/MSC - AFL ACH					
FAA 2020-18-51	APPLIANCE AD - SANDIA AEROSPACE - AIRPLANE FLIGHT MANUAL - SECTION LIMITATIONS - AMENDMENT					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED // CHECKDATE 11 NOV 2020 // WO CHIP-13/20
28-SEP-2020		MOS HRS/MSC - AFL					
FAA 2020-18-51-E	APPLIANCE/EMERGENCY AD - SANDIA AEROSPACE - AIRPLANE FLIGHT MANUAL - SECTION LIMITATIONS - AMENDMENT					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED - CHECKDATE 07 SEP 2020 // CHIP-11/20
31-AUG-2020		MOS HRS/MSC - AFL ACH					
FAA 2020-21-02	APPLIANCE AD - FIRE PROTECTION - KIDDE AEROSPACE & DEFENSE CARGO FIRE EXTINGUISHER HALON BOTTLES - REPLACEMENT					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 11 NOV 2020 // WO CHIP-13/20
19-NOV-2020		MOS HRS/MSC - AFL					
FAA 2020-21-02 PARA (H) & (I)	DO AN INSPECTION TO DETERMINE THE PART NUMBER AND SERIAL NUMBER OF THE CARGO FIRE EXTINGUISHER HALON BOTTLES INSTALLED IN THE CARGO COMPARTMENT AND REPLACE WITH A SERVICEABLE PART AS REQUIRED					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 11 NOV 2020 // WO CHIP-13/20
		MOS HRS/MSC - AFL					
FAA 2020-21-02 PARA (J)	NO PERSON MAY INSTALL ON ANY AIRPLANE AN AFFECTED PART AS IDENTIFIED IN PARAGRAPH (G)(3) OF THIS AD UNLESS THAT PART HAS A CIRCLED LETTER "G" STAMPED AT A DISTANCE 8 OF APPROXIMATELY ONE INCH FROM THE LEFT EDGE OF THE PLACARD, INDICATING THAT THE CARGO FIRE EXTINGUISHER HALON BOTTLE HAS BEEN TESTED AND REFILLED					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 11 NOV 2020 // WO CHIP-13/20
		MOS HRS/MSC - AFL					
LBA D-1994-329 R01	APPLIANCE AD - EROS - FULL FACE MASK OXYGEN REGULATOR VALVE - RADIO CORD HOSE CLAMP INSPECTION / REPLACEMENT					MANDATORY	NOT APPLICABLE - P/N NOT INSTALLED
14-JUN-2017		MOS HRS/MSC - AFL		13-SEP-2017 819:18 704			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
EASA 2019-0235	APPLIANCE AD - EQUIPMENT / FURNISHINGS - EMERGENCY LOCATOR TRANSMITTER - INSPECTION / MODIFICATION / REPLACEMENT					MANDATORY	NOT APPLICABLE - ELT P/N AND S/N ORIGINAL INSTALLED SINCE INITIAL CERTIFICATION OF THE AIRCRAFT // CHECKDATE 07 NOV 2019 // WO CHIP-24/19
04-OCT-2019		MOS HRS/MSC - AFL ACH					
EASA 2019-0235 PARA (1) THRU (4)	CONCURRENTLY ACCOMPLISH PARAS (1.1) AND (1.2) OF THIS AD AND ACCOMPLISH APPLICABLE CORRECTIVE ACTION(S) (IF, DISCREPANCIES ARE DETECTED, AS IDENTIFIED IN THE SIL); OPERATORS MAY CONTINUE TO USE ELTS WITH THE ORIGINAL G-SWITCHES BY REDUCING THE INTERVAL OF THE G-SWITCH TESTING, AS REQUIRED BY PARA (1.1)					MANDATORY	NOT APPLICABLE - ELT P/N AND S/N ORIGINAL INSTALLED SINCE INITIAL CERTIFICATION OF THE AIRCRAFT // CHECKDATE 07 NOV 2019 // WO CHIP-24/19
04-OCT-2019		MOS HRS/MSC - AFL ACH					
EASA 2019-0235 PARA (5)	REMOVE THE AFFECTED PART FROM SERVICE IAW THE INSTRUCTIONS OF SECTION 7 OF THE SB FOR THE PURPOSE OF IN-SHOP MODIFICATION					MANDATORY	NOT APPLICABLE - ELT P/N AND S/N ORIGINAL INSTALLED SINCE INITIAL CERTIFICATION OF THE AIRCRAFT // CHECKDATE 07 NOV 2019 // WO CHIP-24/19
04-OCT-2019		MOS HRS/MSC - AFL ACH					
EASA 2019-0235 PARA (6)	IN-SHOP CORRECTION OF AN AFFECTED PART OR MODIFICATION INTO A SERVICEABLE PART IAW THE INSTRUCTIONS OF THE SB CONSTITUTES TERMINATING ACTION FOR THE REPETITIVE INSPECTIONS AND TESTING AS REQUIRED BY THIS AD FOR THAT PART					MANDATORY	NOT APPLICABLE - ELT P/N AND S/N ORIGINAL INSTALLED SINCE INITIAL CERTIFICATION OF THE AIRCRAFT // CHECKDATE 07 NOV 2019 // WO CHIP-24/19
04-OCT-2019		MOS HRS/MSC - AFL ACH					
EASA 2019-0235 PARA (9)	DO NOT INSTALL ON ANY AIRCRAFT AN AFFECTED PART THAT HAS ACCUMULATED 10 YEAR TIS OR MORE					MANDATORY	NOT APPLICABLE - ELT P/N AND S/N ORIGINAL INSTALLED SINCE INITIAL CERTIFICATION OF THE AIRCRAFT // CHECKDATE 07 NOV 2019 // WO CHIP-24/19
04-OCT-2019		MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
AIRFRAME - SB - 525B-0498/D-CHIP							
# 000001	PROPARTS CONTRACT TERMINATION					INFORMATIONAL	
		MOS	60 (s)	21-SEP-2016			
		HRS/MSC	3000	8:42			
		AFL		6			
ASL ASL525B-33-01 R01	TRANSMITTAL OF BIRK SERVICE BULLETIN SB25-01, INTERIOR LIGHT LAMP SOCKET REPLACEMENT, ALERT SERVICE LETTER					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER &/OR PART NUMBER INSTALLED
		MOS		22-SEP-2016			
		HRS/MSC	-				
		AFL					
ASL ASL525B-52-01	EMERGENCY DOOR INSPECTION, ALERT SERVICE LETTER					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER &/OR PART NUMBER INSTALLED
		DAYS		22-SEP-2016			
		HRS/MSC	-				
		AFL					
	19-NOV-2007						
ASL ASL525B-53-01 R01	RELIEF TUBE CORROSION, ALERT SERVICE LETTER					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER &/OR PART NUMBER INSTALLED
		MOS		22-SEP-2016			
		HRS/MSC	-				
		AFL					
	20-MAY-2008						
ASL ASL525B-53-02 R06	RELIEF TUBE CORROSION INSPECTION, ALERT SERVICE LETTER					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER &/OR PART NUMBER INSTALLED
		MOS		22-SEP-2016			
		HRS/MSC	-				
		AFL					
	11-MAY-2008						
ASL ASL525B-71-03	TRANSMITTAL OF WILLIAMS INTERNATIONAL SERVICE BULLETIN NUMBER FJ44-73-024, REVISION 4, ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.10.01, ALERT SERVICE LETTER					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER &/OR PART NUMBER INSTALLED
		MOS		22-SEP-2016			
		HRS/MSC	-				
		AFL					
	04-NOV-2005						
COM MC 525B-001	525B MODEL SERIES COMMUNIQUE ANNOUNCEMENT, COMMUNIQUE					INFORMATIONAL	
		MOS					
		HRS/MSC	-				
		AFL					
	01-JAN-2018						
COM MC 525B-002	500 COMPRESSOR HOUR INSPECTION, COMMUNIQUE					INFORMATIONAL	
		MOS					
		HRS/MSC	-				
		AFL					
	12-JUL-2019						
COM MC 525B-003	ATA 76 - FADEC PART NUMBER CHANGE, COMMUNIQUE					INFORMATIONAL	
		MOS					
		HRS/MSC	-				
		AFL					
	01-AUG-2019						
COM MC 525B-004	NEW AIR CONDITIONING COMPRESSOR MOTOR FAN, COMMUNIQUE					INFORMATIONAL	
		MOS					
		HRS/MSC	-				
		AFL					
	11-SEP-2019						

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
COM MC 525B-005	PURGE MOISTURE FROM SERVICE AIR PRIOR TO CLOSING DOOR, COMMUNIQUE					INFORMATIONAL	
12-SEP-2019		MOS HRS/MSC - AFL					
COM MC 525B-006	AIRCRAFT RECORDING SYSTEM SOFTWARE, COMMUNIQUE					INFORMATIONAL	
01-APR-2020		MOS HRS/MSC - AFL					
COM MC 525B-007	TEXTRON AVIATION ICA SUPPLEMENTS EXPLAINED, COMMUNIQUE					INFORMATIONAL	
01-OCT-2020		MOS HRS/MSC - AFL					
COM MC 525B-009	LOSS OF GPS SIGNAL, COMMUNIQUE					INFORMATIONAL	
20-NOV-2020		MOS HRS/MSC - AFL					
SB 525B-11-03	GEAR EXTEND SPEED REDUCTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
28-AUG-2006		DAYS HRS/MSC - AFL		22-SEP-2016			
SB 525B-23-01 R01	RADIO TUNING UNIT (RTU) UPDATE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
15-MAY-2008		MOS HRS/MSC - AFL		22-SEP-2016			
SB 525B-23-05	COMMUNICATIONS - AIRCELL ATG ANTENNA BONDING IMPROVEMENTS, SERVICE BULLETIN					RECOMMENDED	
27-OCT-2017		MOS HRS/MSC - AFL					
SB 525B-24-02 R01	RELAY CIRCUIT PROTECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
04-OCT-2007		DAYS HRS/MSC - AFL		22-SEP-2016			
SB 525B-24-05 R01	RIGHT CIRCUIT BREAKER PANEL WIRING MODIFICATION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
04-NOV-2005		MOS HRS/MSC - AFL		22-SEP-2016			
SB 525B-24-08	CIRCUIT BREAKER PANEL HARDWARE IMPROVEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
07-APR-2008		DAYS HRS/MSC - AFL		22-SEP-2016			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB 525B-24-09	GENERATOR CONTROL UNIT WIRE BUNDLE ROUTING, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
		MOS		22-SEP-2016			
		15-FEB-2013	HRS/MSC -				
			AFL				
SB 525B-24-10 R01	ELECTRICAL POWER - POWER JUNCTION BOX (J-BOX) START RELAY MODIFICATION, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
		MOS		29-MAR-2018			
		12-JAN-2018	HRS/MSC -	1168:36			
			AFL	1011			
			ACH	498			
SB 525B-24-11	ELECTRICAL POWER - AUXILIARY BATTERY AND JUNCTION BOX RELOCATION, SERVICE BULLETIN					OPTIONAL	
		MOS					
		23-FEB-2018	HRS/MSC -				
			AFL				
SB 525B-25-08	EQUIPMENT/FURNISHINGS - SEAT CONTROL CABLE ROUTING IMPROVEMENT, SERVICE BULLETIN					DISCRETIONARY	COMPLIED WITH
		MOS		23-JAN-2019			
		06-JUN-2018	HRS/MSC -	1788:32			
			AFL	1543			
SB 525B-25-09	EQUIPMENT/FURNISHINGS - OPTION FOR LARGER HEADSET HOOK, SERVICE BULLETIN					OPTIONAL	
		MOS					
		21-JUL-2020	HRS/MSC -				
			AFL				
SB 525B-26-01	FIRE BOTTLE IDENTIFICATION SLEEVE INSTALLATION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
		MOS		22-SEP-2016			
		05-APR-2005	HRS/MSC -				
			AFL				
SB 525B-26-03	ANNUNCIATOR PANEL REPLACEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
		MOS		22-SEP-2016			
			HRS/MSC -				
			AFL				
SB 525B-27-02 R01	ELEVATOR TRIM POINTER ASSEMBLY IMPROVEMENT, SERVICE BULLETIN					OPTIONAL	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
		MOS		22-SEP-2016			
			HRS/MSC - (s)				
			AFL				
SB 525B-27-03 R01	VERTICAL STABILIZER CABLE FAIRLEAD INSTALLATION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
		MOS		22-SEP-2016			
		22-NOV-2011	HRS/MSC -				
			AFL				
SB 525B-29-01 R02	HYDRAULIC RELIEF VALVE INSPECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
		MOS		22-SEP-2016			
		13-JAN-2009	HRS/MSC -				
			AFL				

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB 525B-29-03 R01	HYDRAULIC POWER - HYDRAULIC RELIEF VALVE STAKING IMPROVEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
06-JUN-2011		MOS HRS/MSC - AFL		22-SEP-2016			
SB 525B-31-02	AILERON, RUDDER AND ELEVATOR POSITION SENSOR ARM TORQUE INSPECTION AND FDR - AILERON SUPPORT BRACKET MODIFICATION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
09-FEB-2010		MOS HRS/MSC - AFL		22-SEP-2016			
SB 525B-32-01	MAIN LANDING GEAR ACTUATOR FIELD REPLACEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY AIRCRAFT S/N
		MOS HRS/MSC - AFL		13-SEP-2017 819:18 704			
SB 525B-32-05	NOSE LANDING GEAR ACTUATOR IMPROVEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
17-JUL-2007		DAYS HRS/MSC - AFL		22-SEP-2016			
SB 525B-32-06	NOSE LANDING GEAR ACTUATOR CYLINDER IMPROVEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
30-JUL-2008		MOS HRS/MSC - AFL		22-SEP-2016			
SB 525B-32-08	MAIN LANDING GEAR BRAKE HYDRAULIC AND PNEUMATIC LINE REPLACEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER & / OR PART NOT INSTALLED
07-JUL-2008		DAYS HRS/MSC - AFL		22-SEP-2016			
SB 525B-33-05	ELECTROLUMINESCENT PANEL MOUNTING IMPROVEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
01-MAY-2012		MOS HRS/MSC - AFL		22-SEP-2016			
SB 525B-34-11	GPS-4000S RECEIVER IMPROVEMENT, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
14-JAN-2010		DAYS HRS/MSC - AFL		22-SEP-2016			
SB 525B-34-30	NAVIGATION - ADS-B OUT WIRING MODIFICATION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - BY AIRCRAFT S/N
22-AUG-2017		MOS HRS/MSC - AFL		13-SEP-2017 819:18 704			
SB 525B-36-01	PNE-BELLOWS SUPPLIER CHANGE, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
		MOS HRS/MSC - AFL		22-SEP-2016			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB 525B-52-02	AFT CABIN SKIN INSPECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
	26-MAR-2009	MOS HRS/MSC - AFL		22-SEP-2016			
SB 525B-53-01 R01	DISABLE THE COCKPIT MOUNTED RELIEF TUBE(S), SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
	04-OCT-2007	DAYS HRS/MSC - AFL		22-SEP-2016			
SB 525B-54-01	LOWER AFT PYLON DOUBLER AND SKIN INSPECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
	30-MAR-2007	MOS HRS/MSC - AFL		22-SEP-2016			
SB 525B-57-01	KEEL FITTING INSPECTION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
	25-JAN-2010	MOS HRS/MSC - AFL		22-SEP-2016			
SB 525B-71-03	COWL STIFFENER INSTALLATION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
	08-OCT-2013	MOS HRS/MSC - AFL		22-SEP-2016			
SB 525B-73-01	ENGINE FUEL AND CONTROL - FUEL CONTROL UNIT (FCU) FIELD REPLACEMENT, SERVICE BULLETIN					OPTIONAL	
	12-AUG-2019	MOS HRS/MSC - AFL					
SB 525B-76-04	ENGINE CONTROLS - UPDATED FJ44-3A FULL AUTHORITY ENGINE CONTROL (FADEC) FIELD REPLACEMENT, SERVICE BULLETIN					OPTIONAL	
	12-AUG-2019	MOS HRS/MSC - AFL					
SB CASSB1480 ISSUE A	TAMARACK ATLAS ENHANCEMENTS IMPLEMENTATION, SERVICE BULLETIN					MANDATORY	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 15 AUG 2019 // WO CHIP-19/19
	11-JUL-2019	MOS HRS/MSC - AFL ACH					
SL CIL-03-01	CERTIFICATION REQUIREMENTS - SUPPLEMENTAL TYPE CERTIFICATE (STC), SERVICE LETTER					INFORMATIONAL	
	03-JUN-2013	MOS HRS/MSC - AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL CIL-20-01 R02	STANDARD PRACTICES - CESSNA CERTIFICATION OF NONDESTRUCTIVE TESTING FACILITIES/PERSONNEL, SERVICE LETTER					INFORMATIONAL	
18-MAR-2014		MOS HRS/MSC - AFL					
SL CIL-25-02	EQUIPMENT/FURNISHINGS - MEDAIRE AIRCRAFT FIRST AID KITS WITH MEDICATION SUBJECT TO RECALL NOTICE, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - S/N AIRCRAFT NOT AFFECTED // CHECKDATE 24 JAN 2020 // WO CHIP-01/20
05-NOV-2019		MOS HRS/MSC - AFL ACH					
SL CIL-25-03	EQUIPMENT/FURNISHINGS - SEAT PAN TILT BLOCKING TAB INSTALLATION, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - S/N AIRCRAFT NOT AFFECTED // CHECKDATE 07 SEP 2020 // CHIP-11/20
12-AUG-2020		MOS HRS/MSC - AFL ACH					
SL CIL-25-03 R01	EQUIPMENT/FURNISHINGS - SEAT PAN TILT BLOCKING TAB INSTALLATION, SERVICE LETTER					INFORMATIONAL	NOT APPLICABLE - S/N AIRCRAFT NOT AFFECTED // CHECKDATE 11 NOV 2020 // WO CHIP-13/20
08-OCT-2020		MOS HRS/MSC - AFL					
SL CIL-30-01 R01	ICE AND RAIN PROTECTION - APPROVED DEICING PROGRAM UPDATES, SERVICE LETTER					INFORMATIONAL	
13-SEP-2013		MOS HRS/MSC - AFL					
SL CIL-31-01	INDICATING/RECORDING SYSTEMS - CVR, FDR, AND CVDR 90-DAY BATTERY UNDERWATER LOCATOR BEACON (ULB) INSTALLATION, SERVICE LETTER					INFORMATIONAL	
02-FEB-2018		MOS HRS/MSC - AFL					
SL CIL-32-01	LANDING GEAR - IMPROVED NOSE WHEEL GREASE SEAL, SERVICE LETTER					INFORMATIONAL	
07-FEB-2013		MOS HRS/MSC - AFL					
SL CIL-32-04	WIRELESS TIRE PRESSURE MONITORING SYSTEM INSTALLATION, SERVICE LETTER					INFORMATIONAL	
25-SEP-2014		MOS HRS/MSC - AFL					
SL CIL-32-06	LANDING GEAR - WIRELESS TIRE PRESSURE SENSOR FILL VALVE TORQUE VERIFICATION, SERVICE LETTER					INFORMATIONAL	
09-MAR-2020		MOS HRS/MSC - AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL CIL-33-01	TRANSMITTAL OF RADIANT POWER CORP. SB-RPC-001, PROCEDURE TO REPLACE OBSOLETE CONNECTOR ASSEMBLY FOR CBS28 EMERGENCY BATTERY, SERVICE LETTER					INFORMATIONAL	
	13-JUN-2013	MOS HRS/MSC - AFL					
SL CIL-34-05 R01	TRANSMITTAL OF GARMIN SERVICE ALERT 1478, LP AND LPV APPROACHES, SERVICE LETTER					MANDATORY	DECLINED - REVISION 1 CANCELED THE CIL
	13-FEB-2015	MOS HRS/MSC - AFL					
SL CIL-34-07	NAVIGATION - TRANSMITTAL OF GARMIN SERVICE ADVISORY 1604 WORLDWIDE NAVIGATION DATABASE, SERVICE LETTER					INFORMATIONAL	
	23-MAR-2016	MOS HRS/MSC - AFL					
SL CIL-35-01	TRANSMITTAL OF BE AEROSPACE SERVICE BULLETIN 118077-35-01, SERVICE LETTER					MANDATORY	NOT APPLICABLE - BY MODEL, SERIAL NUMBER &/OR PART NUMBER INSTALLED
	14-NOV-2013	MOS HRS/MSC - (s) AFL		22-SEP-2016			
SL CIL-35-05	OXYGEN - TRANSMITTAL OF ZODIAC AEROSPACE SB MCF-SBU-35-001, SERVICE LETTER					MANDATORY	NOT APPLICABLE
	08-JAN-2016	DAYS HRS/MSC - AFL		23-SEP-2016 20:54 10			
SL CIL-52-01	DOORS - EMERGENCY DOOR INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE
	27-NOV-2012	MOS HRS/MSC - AFL		23-SEP-2016 20:54 10			
SL CIL-52-02	DOORS - EMERGENCY EXIT DOOR INSPECTION, SERVICE LETTER					INFORMATIONAL	
	28-JUL-2020	MOS HRS/MSC - AFL					
SL CIL-52-03	DOORS - EMERGENCY ESCAPE HATCH INSPECTION, SERVICE LETTER					MANDATORY	
	04-NOV-2020	MOS HRS/MSC AFL	12 600	(EFF)	04-NOV-2021 3565:50		
SL CIL-99-01 R02	USE OF CORROSION INHIBITING COMPOUNDS, SERVICE LETTER					INFORMATIONAL	
	02-JUL-2015	MOS HRS/MSC - AFL					
SL CIL-99-01 R03	MISCELLANEOUS - USE OF CORROSION INHIBITING COMPOUNDS, SERVICE LETTER					INFORMATIONAL	DECLINED - CANCELED BY MANUFACTURER
	14-AUG-2019	MOS HRS/MSC - AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL CIL-99-02	MISCELLANEOUS - AVOID OPERATIONS ON RUNWAYS TREATED WITH RUNWAY DE-ICE (RDI) FLUIDS. AIRCRAFT WASHING RECOMMENDED AFTER EXPOSURE TO RDI FLUIDS, SERVICE LETTER					RECOMMENDED	
		MOS					
	23-MAY-2012	HRS/MSC -					
		AFL					
SL CIL-99-02 R01	MISCELLANEOUS - AVOID OPERATIONS ON RUNWAYS TREATED WITH RUNWAY DE-ICE (RDI) FLUIDS. AIRCRAFT WASHING RECOMMENDED AFTER EXPOSURE TO RDI FLUIDS, SERVICE LETTER					INFORMATIONAL	DECLINED - CANCELED BY MANUFACTURER
		MOS					
	14-AUG-2019	HRS/MSC -					
		AFL					
SL CIL-99-03 R01	MISCELLANEOUS - CORROSION PREVENTION AND CONTROL PROGRAM (CPCP), SERVICE LETTER					RECOMMENDED	
		MOS					
	25-MAR-2013	HRS/MSC -					
		AFL					
SL CIL-99-03 R02	MISCELLANEOUS - CORROSION PREVENTION AND CONTROL PROGRAM (CPCP), SERVICE LETTER					RECOMMENDED	DECLINED - CANCELED BY MANUFACTURER
		MOS					
	14-AUG-2019	HRS/MSC -					
		AFL					
SL CIL-99-04	MISCELLANEOUS - INCREMENTAL LIBRARY UPDATES FOR CESVIEW, SERVICE LETTER					INFORMATIONAL	
		MOS					
	29-JAN-2016	HRS/MSC -					
		AFL					
SL CIL-99-04 R01	MISCELLANEOUS - INCREMENTAL LIBRARY UPDATES FOR CESVIEW, SERVICE LETTER					INFORMATIONAL	DECLINED - CANCELED BY MANUFACTURER
		MOS					
	14-AUG-2019	HRS/MSC -					
		AFL					
SL SL525B-05-01	CORROSIVE ENVIRONMENT INSPECTION, SERVICE LETTER					INFORMATIONAL	
		MOS					
	23-FEB-2006	HRS/MSC -					
		AFL					
SL SL525B-20-01 R07	SUPERSEDED BY CIL-20-01 R2, SERVICE LETTER					INFORMATIONAL	
		MOS					
	21-SEP-2012	HRS/MSC -					
		AFL					
SL SL525B-20-04	STANDARD PRACTICES - LOCKWIRE VERIFICATION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - BY AIRCRAFT S/N
		MOS			13-SEP-2017		
	04-APR-2017	HRS/MSC -			819:18		
		AFL			704		
SL SL525B-20-05	STANDARD PRACTICES - CESSNA STANDARD PRACTICES MANUAL, SERVICE LETTER					INFORMATIONAL	
		MOS					
	05-OCT-2017	HRS/MSC -					
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-21-02	AIR CONDITIONING - DIVERTER DUCT AIR CYLINDER VERIFICATION, SERVICE LETTER					RECOMMENDED	COMPLIED WITH
14-AUG-2017		MOS		19-OCT-2017			
		HRS/MSC -		907:36			
		AFL		783			
		ACH		398			
SL SL525B-21-06	AIR CONDITIONING - AIR CONDITIONING COMPRESSOR MOTOR FAN REPLACEMENT, SERVICE LETTER					OPTIONAL	COMPLIED WITH
16-AUG-2019		MOS		25-OCT-2019			
		HRS/MSC -		2325:28			
		AFL		2013			
SL SL525B-21-07	AIR CONDITIONING - FORWARD EVAPORATOR MOTOR ASSEMBLY INSPECTION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - S/N AIRCRAFT NOT AFFECTED // CHECKDATE 06 AUG 2020 // WO CHIP-08/20
20-MAY-2020		MOS					
		HRS/MSC -					
		AFL					
		ACH					
SL SL525B-23-01 R01	COMMUNICATIONS - GARMIN GMA 36 MODIFICATION LEVEL VERIFICATION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - BY AIRCRAFT S/N
25-JAN-2017		MOS		13-SEP-2017			
		HRS/MSC -		819:18			
		AFL		704			
SL SL525B-23-02	COMMUNICATIONS - LINK 2000+ CPDLC AND VHF ACARS CONFIGURATION VERIFICATION, SERVICE LETTER					RECOMMENDED	
25-JAN-2017		MOS					
		HRS/MSC -					
		AFL					
SL SL525B-23-03	COMMUNICATIONS - SITA DATALINK FREQUENCY CHANGE FOR NORTH AMERICA, SERVICE LETTER					INFORMATIONAL	
12-MAY-2017		MOS					
		HRS/MSC -					
		AFL					
SL SL525B-23-04	COMMUNICATIONS - ATG 5000 SOFTWARE UPDATE, SERVICE LETTER					OPTIONAL	
12-SEP-2017		MOS					
		HRS/MSC -					
		AFL					
SL SL525B-23-05	COMMUNICATIONS - ATG 5000 SOFTWARE UPDATE TO VERSION 2.8, SERVICE LETTER					OPTIONAL	NOT APPLICABLE - EQUIPMENT NOT INSTALLED // CHECKDATE 20 JUN 2018 // WO DCHIP-11/18
25-JAN-2018		MOS					
		HRS/MSC -					
		AFL					
		ACH					
SL SL525B-24-01	POWER J-BOX INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
15-MAY-2006		MOS		22-SEP-2016			
		HRS/MSC -					
		AFL					
SL SL525B-24-02	TAIL DE-ICE CONTROL PRINTED CIRCUIT BOARD (PCB) INSPECTION/REPLACEMENT, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
25-JAN-2012		MOS		22-SEP-2016			
		HRS/MSC -					
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-25-01	TRANSMITTAL OF PACIFIC SCIENTIFIC AEROSPACE SERVICE BULLETIN SB 25-111432, INFORMATION REGARDING THE POTENTIAL FAILURE OF THE GUARDED ROTARY BUCKLE PLASTIC HANDLE, SERVICE LETTER	MOS		22-SEP-2016		MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
10-DEC-2007		HRS/MSC - AFL					
SL SL525B-25-02	INSPECTION OF THE BACKREST LATCH PLATES, SERVICE LETTER	MOS		22-SEP-2016		MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
28-SEP-2009		HRS/MSC - AFL					
SL SL525B-25-03	EQUIPMENT/FURNISHINGS - TRANSMITTAL OF B/E AEROSPACE SERVICE BULLETIN 2524.565-25-01 REPLACEMENT OF SWIVEL ASSEMBLY, SERVICE LETTER	MOS		22-SEP-2016		MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
06-OCT-2010		HRS/MSC - AFL					
SL SL525B-25-05	EQUIPMENT/FURNISHINGS - TOILET DRIP TRAY INSTALLATION, SERVICE LETTER	MOS				OPTIONAL	
14-MAY-2018		HRS/MSC - AFL					
SL SL525B-25-06	EQUIPMENT/FURNISHINGS - PASSENGER SEAT INSTRUCTION PLACARD INSPECT AND REPLACE, SERVICE LETTER	DAYS				MANDATORY	NOT APPLICABLE - BY AIRCRAFT S/N // CHECKDATE 14 AUG 2018 // WO CHIP-18/18
17-JUL-2018		HRS/MSC - AFL ACH					
SL SL525B-25-07	EQUIPMENT/FURNISHINGS - TRANSMITTAL OF AMSAFE SERVICE BULLETIN SB514633, REMOVAL AND REPLACEMENT OF BUCKLE ASSEMBLY PART NUMBERS 505703, 504443, AND 511442, SERVICE LETTER	DAYS				MANDATORY	NOT APPLICABLE - S/N AIRCRAFT NOT AFFECTED // CHECKDATE 07 NOV 2019 // WO CHIP-24/19
01-OCT-2019		HRS/MSC - AFL ACH					
SL SL525B-25-08	EQUIPMENT/FURNISHINGS - MODIFICATION OF THE PASSENGER SEATS, SERVICE LETTER	MOS		25-OCT-2019		OPTIONAL	COMPLIED WITH
07-AUG-2019		HRS/MSC - AFL		2325:28 2013			
SL SL525B-25-09	EQUIPMENT/FURNISHINGS - INSPECTION OF THE MILLENNIUM CREW SEAT ASSEMBLIES FOR INCORRECTLY INSTALLED SEAT PAN TILT MECHANISM SNAP RINGS (MILLENNIUM SERVICE BULLETIN SB2049-25-20-02) (SUPERSEDED BY SL525B-25-09 R01), SERVICE LETTER	MOS				RECOMMENDED	NOT APPLICABLE - S/N AIRCRAFT NOT AFFECTED // CHECKDATE 07 NOV 2019 // WO CHIP-24/19
10-SEP-2019		HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-25-09 R01	EQUIPMENT/FURNISHINGS - REPLACEMENT OF THE SEAT PAN TILT SNAP RINGS (MILLENNIUM SERVICE BULLETIN SB2049-25-20-02B), SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - S/N AIRCRAFT NOT AFFECTED // CHECKDATE 24 JAN 2020 // WO CHIP-01/20
21-NOV-2019		MOS HRS/MSC - AFL ACH					
SL SL525B-27-02	FLIGHT CONTROLS - FLAP ACTUATOR LIMIT SWITCH WIRING IMPROVEMENT, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - BY AIRCRAFT S/N
13-DEC-2016		MOS HRS/MSC - AFL		13-SEP-2017 819:18 704			
SL SL525B-27-03	FLIGHT CONTROLS - ELEVATOR TRIM TAB PUSHROD REPLACEMENT, SERVICE LETTER					RECOMMENDED	COMPLIED WITH
02-APR-2019		MOS HRS/MSC - AFL		12-JUN-2019 2066:52 1798			
SL SL525B-28-01	FUEL LINE CLEARANCE IMPROVEMENT, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
10-DEC-2008		DAYS HRS/MSC - AFL		22-SEP-2016			
SL SL525B-29-02	HYDRAULIC POWER - ENGINE DRIVEN HYDRAULIC PUMP VERIFICATION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - BY AIRCRAFT S/N
13-JUN-2017		MOS HRS/MSC - AFL		13-SEP-2017 819:18 704			
SL SL525B-30-01 R08	SUPERSEDED BY CIL-30-01, SERVICE LETTER					INFORMATIONAL	
08-OCT-2012		MOS HRS/MSC - AFL					
SL SL525B-30-02	ICE AND RAIN PROTECTION - WING ANTI-ICE PRESSURE REGULATING SHUTOFF VALVE INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
09-DEC-2010		DAYS HRS/MSC - AFL		22-SEP-2016			
SL SL525B-31-04	INDICATING/RECORDING SYSTEMS - INDICATING/RECORDING - ARES SOFTWARE UPDATE, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
14-NOV-2011		MOS HRS/MSC - AFL		22-SEP-2016			
SL SL525B-32-01 R01	NOSE LANDING GEAR ICE PROTECTION BOOT INSTALLATION, SERVICE LETTER					OPTIONAL	
28-JUL-2005		MOS HRS/MSC - AFL					
SL SL525B-32-02	MAIN LANDING GEAR SIMULATOR TEST BOX, SERVICE LETTER					INFORMATIONAL	
18-SEP-2006		MOS HRS/MSC A/R AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-32-07	TRANSMITTAL OF GOODRICH SERVICE LETTER SL2060, LANDING GEAR - MAIN WHEEL ASSEMBLY - INTRODUCTION OF AN IMPROVED OPTIONAL THERMAL RELIEF PLUG ASSEMBLY, SERVICE LETTER	MOS				INFORMATIONAL	
26-MAR-2009		HRS/MSC	A/R				
		AFL					
SL SL525B-32-09 R02	EMERGENCY GEAR RELEASE INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
12-MAY-2010		MOS		22-SEP-2016			
		HRS/MSC	-				
		AFL					
SL SL525B-32-10	LANDING GEAR - MAIN LANDING GEAR TIRE INFLATION PLACARD INSPECTION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
11-MAY-2011		MOS		22-SEP-2016			
		HRS/MSC	-				
		AFL					
SL SL525B-32-12	LANDING GEAR - REPLACE THE DIGITAL ANTISKID CONTROL BOX, SERVICE LETTER					MANDATORY	NOT APPLICABLE - NA BY AIRCRAFT SN // CHECKDATE 26 JUN 2019 // WO CHIP-12/19
04-JUN-2019		DAYS					
		HRS/MSC	-				
		AFL					
		ACH					
SL SL525B-32-13	LANDING GEAR - EMERGENCY BRAKE VALVE ASSEMBLY INSPECTION, SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - S/N AIRCRAFT NOT AFFECTED // CHECKDATE 06 AUG 2020 // WO CHIP-08/20
04-MAY-2020		MOS					
		HRS/MSC	-				
		AFL					
		ACH					
SL SL525B-32-14	LANDING GEAR - MAIN LANDING GEAR REPAIR, SERVICE LETTER					INFORMATIONAL	
02-NOV-2020		MOS					
		HRS/MSC	-				
		AFL					
SL SL525B-34-01	TRANSMITTAL OF GARMIN SERVICE ALERT, DIRECT-TO-WAYPOINT SELECTION SERVICE ALERT: 050721-00, SERVICE LETTER					INFORMATIONAL	
16-DEC-2005		MOS					
		HRS/MSC	A/R				
		AFL					
SL SL525B-34-04	TRANSMITTAL OF L-3 COMMUNICATIONS AVIONICS SYSTEMS' SERVICE LETTER SL-230 (REV. A), SERVICE LETTER					INFORMATIONAL	
16-SEP-2008		MOS					
		HRS/MSC	A/R				
		AFL					
SL SL525B-34-05 R01	CONFIGURATION FOR AUSTRALIA, SINGAPORE FIR, AND HONG KONG ADS-B OUT (CANCELLED BY SL525B-34-05 R02), SERVICE LETTER					OPTIONAL	
13-NOV-2013		MOS					
		HRS/MSC	-				
		AFL					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-34-06	TRANSMITTAL OF GARMIN SERVICE ADVISORY NO. 1433 POTENTIAL GWX 70 POWER AMPLIFIER FAILURE IN GROUND MAP MODE, SERVICE LETTER					INFORMATIONAL	
12-SEP-2014		MOS HRS/MSC - AFL					
SL SL525B-34-07	NAVIGATIONAL - TRANSMITTAL OF GARMIN SERVICE ADVISORY NO. 1529, PROCEDURE LEGS IN TERMINAL PROCEDURES, SERVICE LETTER					INFORMATIONAL	
28-AUG-2015		MOS HRS/MSC - AFL					
SL SL525B-34-08	NAVIGATIONAL - TRANSMITTAL OF GARMIN SERVICE ADVISORY NO. 1514, POTENTIAL ERRONEOUS LATERAL GUIDANCE, SERVICE LETTER					INFORMATIONAL	
28-AUG-2015		MOS HRS/MSC - AFL					
SL SL525B-34-10 R01	NAVIGATION - TRANSMITTAL OF GARMIN SERVICE ADVISORY NO 1612 2015 IGRF (INTERNATIONAL GEOMAGNETIC REFERENCE FIELD) MAGNETIC FIELD MODEL, SERVICE LETTER					INFORMATIONAL	
19-SEP-2016		MOS HRS/MSC - AFL					
SL SL525B-34-11	NAVIGATION - TRANSMITTAL OF GARMIN SERVICE ADVISORY 1802 INCORRECT DIRECT-TO NAVIGATION FOLLOWING INTERCEPT (INTRCPT) LEG AND SERVICE ADVISORY 1822 DME/DME NAVIGATION, SERVICE LETTER					INFORMATIONAL	
12-JUL-2018		MOS HRS/MSC - AFL					
SL SL525B-34-13	NAVIGATION - TRANSMITTAL OF GARMIN SB 1994, GRS 77 SOFTWARE VERSION 3.04 - PITCH/ROLL OFFSET CALIBRATION PROCEDURE, SERVICE LETTER					INFORMATIONAL	
17-MAR-2020		MOS HRS/MSC - AFL					
SL SL525B-35-02 R02	OXYGEN - TRANSMITTAL OF INTERTECHNIQUE SERVICE BULLETIN MXH-35-240, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
25-OCT-2012		MOS HRS/MSC - AFL		22-SEP-2016			
SL SL525B-36-02	ENGINE BLEED AIR TUBE CLAMP INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
29-MAY-2015		DAYS HRS/MSC - AFL		22-SEP-2016			
SL SL525B-53-07	UPPER TAILCONE SKIN INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
03-JUN-2010		MOS HRS/MSC - AFL		22-SEP-2016			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL SL525B-55-01	HORIZONTAL STABILIZER RIB INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
	15-DEC-2008	MOS HRS/MSC - AFL		22-SEP-2016			
SL SL525B-57-04	WING STATION 48.00 RIB INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
	21-MAY-2015	MOS HRS/MSC - AFL		22-SEP-2016			
SL SL525B-71-05	TRANSMITTAL OF WILLIAMS INTERNATIONAL SERVICE BULLETIN FJ44-72-062R3, ENGINE - GEARBOX INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
	10-JUL-2006	MOS HRS/MSC - AFL		22-SEP-2016			
SL SL525B-71-07	DESALINIZATION RINSE - REMOVE BLEED CAP REQUIREMENT, SERVICE LETTER					INFORMATIONAL	
	10-NOV-2006	MOS HRS/MSC - AFL					
SL SL525B-71-08 R01	POWER PLANT - FUEL AND HYDRAULIC HOSE REPLACEMENT, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
	14-OCT-2015	MOS HRS/MSC - AFL		22-SEP-2016			
SL SL525B-71-09	POWER PLANT - ENGINE ISOLATOR MOUNTS INSPECTION EXTENSION (SUPERSEDED BY SL525B-71-09 R01), SERVICE LETTER					OPTIONAL	NOT APPLICABLE - SN NOT AFFECTED // CHECKDATE 27 DEC 2018 // WO CHIP-24/18 REV 01
	07-DEC-2018	MOS HRS/MSC - AFL ACH					
SL SL525B-71-09 R01	POWER PLANT - ENGINE ISOLATOR MOUNTS INSPECTION EXTENSION, SERVICE LETTER					OPTIONAL	NOT APPLICABLE - AIRCRAFT SN NOT AFFECTED // CHECKDATE 22 MAR 2019 // WO CHIP-06/19
	27-FEB-2019	MOS HRS/MSC - AFL ACH					
SL SL525B-73-01 R01	FDU DIAPHRAGM INSPECTION, SERVICE LETTER					MANDATORY	NOT APPLICABLE - N/A BY MODEL SERIAL NUMBER. & / OR PART NOT INSTALLED
	02-AUG-2006	DAYS HRS/MSC - AFL		22-SEP-2016			
SL SL525B-80-01	STARTING - STARTER-GENERATOR EXHAUST DUCT INSTALLATION VERIFICATION (SUPERSEDED BY SL525B-80-01 R01), SERVICE LETTER					RECOMMENDED	NOT APPLICABLE - BY S/N // CHECKDATE 27 DEC 2018 // WO CHIP24/18 REV 01
	18-SEP-2018	MOS HRS/MSC - AFL ACH					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL 05-OCT-2018	SL525B-80-01 R01 STARTING - STARTER-GENERATOR EXHAUST DUCT INSTALLATION VERIFICATION, SERVICE LETTER	MOS HRS/MSC - AFL ACH				RECOMMENDED	NOT APPLICABLE - BY S/N // CHECKDATE 27 DEC 2018 // WO CHIP24/18 REV 01
SL 01-JUN-2013	SL525B-99-01 R03 CESCOME PRICES (THIS SL CANCELS SL525B-99-01 R2 AND PREVIOUS), SERVICE LETTER	MOS HRS/MSC - AFL				INFORMATIONAL	
SL 25-AUG-2015	SL525B-99-03 R02 MISCELLANEOUS - TRANSMITTAL OF CESSNA'S CERTIFICATION REQUIREMENTS FOR PORTABLE ELECTRONIC DEVICE USAGE, SERVICE LETTER	MOS HRS/MSC - AFL				INFORMATIONAL	
SL 11-NOV-2011	SL525B-99-04 MISCELLANEOUS - CESSNA PART NUMBER SUFFIXES FOR REMANUFACTURED PARTS, SERVICE LETTER	MOS HRS/MSC A/R AFL				INFORMATIONAL	
SL 22-NOV-2011	SL525B-99-05 MISCELLANEOUS - CESSNA SERVICE DOCUMENT CHANGE NOTIFICATION, SERVICE LETTER	MOS HRS/MSC A/R AFL				INFORMATIONAL	
SL 17-AUG-2017	SL525B-99-08 MISCELLANEOUS - TRANSMITTAL OF ROCKWELL COLLINS OPERATORS BULLETIN (OPSB) 0166-17 - THE FMS MAY TURN IN THE WRONG DIRECTION AFTER SEQUENCING A "CLIMB TO" ALTITUDE THAT WAS MANUALLY EDITED OR TEMPERATURE COMPENSATED, SERVICE LETTER	MOS HRS/MSC - AFL				INFORMATIONAL	

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
ENGINE NO. 1 - SB - 216092/75000-200							
SB	FJ44-05-002	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION (SUPERSEDED BY FJ44-05-002 R01), SERVICE BULLETIN				INFORMATIONAL	
	02-OCT-2015		MOS HRS/MSC - AFL				
SB	FJ44-05-002 R01	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION (SUPERSEDED BY FJ44-05-002 R02), SERVICE BULLETIN				INFORMATIONAL	
	22-MAY-2017		MOS HRS/MSC - ENC				
SB	FJ44-05-002 R02	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN				INFORMATIONAL	
	17-AUG-2017		MOS HRS/MSC - ENC				
SB	FJ44-05-002 R03	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN				INFORMATIONAL	
	12-MAR-2019		MOS HRS/MSC - ENC				
SB	FJ44-05-002 R04	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN				INFORMATIONAL	
	01-OCT-2019		MOS HRS/MSC - ENC				
SB	FJ44-05-002 R05	NO. 1 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN				INFORMATIONAL	
	24-MAR-2020		MOS HRS/MSC - ENC				
SB	FJ44-05-002 R05-CN	NO. 1 ENGINE - SUPERSEDED - UNSERVICEABLE PARTS - NOTIFICATION (THIS SERVICE DOCUMENT HAS BEEN SUPERSEDED BY WIPSID-05-1000), SERVICE BULLETIN				CANCELLED	
	07-APR-2020		MOS HRS/MSC - ENC				
SB	FJ44-72-066 R02	NO. 1 ENGINE - ENGINE - HOUSING, CARBON RING SEAL AND BEARING (NO. 3 BEARING RETAINER) - REPLACE (SUPERSEDED BY FJ44-72-066 R03), SERVICE BULLETIN				RECOMMENDED	
	16-DEC-2010		MOS HRS/MSC - ENC				
SB	FJ44-72-066 R03	NO. 1 ENGINE - ENGINE - CARBON RING SEAL AND BEARING HOUSING - REPLACE (SUPERSEDED BY FJ44-72-066 R04), SERVICE BULLETIN				RECOMMENDED	
	03-JUN-2011		MOS HRS/MSC - ENC				
SB	FJ44-72-066 R06	NO. 1 ENGINE - CARBON RING SEAL AND BEARING HOUSING - REPLACE, SERVICE BULLETIN				RECOMMENDED	
	09-DEC-2015		MOS HRS/MSC - ENC				

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-068 R03	NO. 1 ENGINE - ENGINE - UPGRADE GEARBOX (4K MAGSEAL) TO SPRING LOADED CONFIGURATION (SUPERSEDED BY FJ44-72-068 R04), SERVICE BULLETIN					OPTIONAL	
05-OCT-2010		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-070 R02	NO. 1 ENGINE - CANCELLED - UPGRADE GEARBOX (4K SPRING-LOADED) TO IMPROVED CONFIGURATION (SUPERSEDED BY SB FJ44-72-105 R01), SERVICE BULLETIN					CANCELLED	
18-DEC-2009		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-078 R01	NO. 1 ENGINE - ENGINE - IP COMPRESSOR STATOR (STAGE 1-2) - REWORK (SUPERSEDED BY FJ44-72-078 R02), SERVICE BULLETIN					OPTIONAL	COMPLIED WITH
15-APR-2013		MOS		01-AUG-2013			
		HRS/MSC	-	1984			
		ENC		1477			
SB FJ44-72-080	NO. 1 ENGINE - ENGINE - 2ND REDUCTION BEVEL GEAR BALL BEARING (GEARBOX ASSEMBLY) - REMOVE AND REPLACE (SUPERSEDED BY FJ44-72-080 R01), SERVICE BULLETIN					RECOMMENDED	
28-OCT-2009		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-085 R05	NO. 1 ENGINE - ENGINE - IP BLEED VALVE - REPLACE (SUPERSEDED BY FJ44-72-085 R06), SERVICE BULLETIN					RECOMMENDED	
20-MAY-2011		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-086 R03	NO. 1 ENGINE - ENGINE - BLEED VALVE SHAFT - REPLACE, SERVICE BULLETIN					RECOMMENDED	
05-OCT-2010		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-093 R09	NO. 1 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY (SUPERSEDED BY FJ44-72-093 R10), SERVICE BULLETIN					MANDATORY	COMPLIED WITH - FJ44-72-093 R9 NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE SERVICE BULLETIN COMPLIED WITH
29-NOV-2011		MOS		05-APR-2012			
		HRS/MSC	-	1650:24			
		ENC					
SB FJ44-72-097 R03	NO. 1 ENGINE - ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-097 R04), SERVICE BULLETIN					MANDATORY	COMPLIED WITH
23-APR-2013		MOS		01-AUG-2013			
		HRS/MSC	-	129:49			
		ENC		-32			
SB FJ44-72-097 R04	NO. 1 ENGINE - CANCELLED - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-151 R05), SERVICE BULLETIN					MANDATORY	
04-MAY-2015		MOS					
		HRS/MSC	-				
		ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-107	NO. 1 ENGINE - ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE (SUPERSEDED BY FJ44-72-107 R01), SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
20-MAR-2013		MOS		01-AUG-2013			
		HRS/MSC -		1984			
		ENC		1477			
SB FJ44-72-107 R02	NO. 1 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					RECOMMENDED	
24-MAR-2015		MOS					
		HRS/MSC DUE					
		ENC					
SB FJ44-72-107 R03	NO. 1 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN					RECOMMENDED	
11-OCT-2019		MOS		(EFF)			
		HRS/MSC CSI			4000 M		
		ENC					
SB FJ44-72-108	NO. 1 ENGINE - ACCESSORY DRIVE SHAFT - REPLACE (SUPERSEDED BY FJ44-72-108 R01), SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
17-APR-2013		MOS		01-AUG-2013			
		HRS/MSC -		1984			
		ENC		1477			
SB FJ44-72-108 R01-CN	NO. 1 ENGINE - SUPERSEDED - ACCESSORY DRIVE SHAFT - REPLACE (THIS SERVICE DOCUMENT IS NO LONGER AVAILABLE), SERVICE BULLETIN					CANCELLED	
18-JUN-2020		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-72-109	NO. 1 ENGINE - ENGINE - 1ST REDUCTION BEVEL GEAR BALL BEARING - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
17-APR-2013		MOS		01-AUG-2013			
		HRS/MSC -		1984			
		ENC		1477			
SB FJ44-72-110	NO. 1 ENGINE - ENGINE - DAMPENER BRACKET ASSEMBLY - REPLACE, SERVICE BULLETIN					MANDATORY	COMPLIED WITH
17-APR-2013		MOS		01-AUG-2013			
		HRS/MSC -		1984			
		ENC		1477			
SB FJ44-72-122-CN	NO. 1 ENGINE - SUPERSEDED - ENGINE - ACCESSORY DRIVE SHAFT - REPLACE, SERVICE BULLETIN					CANCELLED	
06-DEC-2019		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-72-123 R01	NO. 1 ENGINE - CANCELLED - INNER GUIDED ROLLER BEARING (NO. 3 BEARING) - REPLACE, SERVICE BULLETIN					CANCELLED	
31-MAR-2015		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-72-124 R02	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE (SUPERSEDED BY FJ44-72-124 R03), SERVICE BULLETIN					RECOMMENDED	
20-NOV-2017		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-72-124 R03	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
06-FEB-2018		MOS					
		HRS/MSC -					
		ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-124 R04	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
	04-MAY-2018	MOS	HRS/MSC -	ENC			
SB FJ44-72-124 R06	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
	27-MAY-2020	MOS	HRS/MSC -	ENC			
SB FJ44-72-124 R07	NO. 1 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
	10-DEC-2020	MOS	HRS/MSC -	ENC			
SB FJ44-72-130	NO. 1 ENGINE - HP COMPRESSOR ROTOR - INSPECTION (SUPERSEDED BY FJ44-72-130 R01), SERVICE BULLETIN					RECOMMENDED	
	05-MAR-2015	MOS	HRS/MSC -	ENC			
SB FJ44-72-130 R01	NO. 1 ENGINE - HP COMPRESSOR ROTOR - INSPECTION (SUPERSEDED BY FJ44-72-130 R02), SERVICE BULLETIN					RECOMMENDED	
	08-MAY-2017	MOS	HRS/MSC -	ENC			
SB FJ44-72-130 R02	NO. 1 ENGINE - HP COMPRESSOR ROTOR - INSPECTION, SERVICE BULLETIN			(EFF)		RECOMMENDED	
	06-FEB-2018	MOS	HRS/MSC DUE	ENC	4484 M		
SB FJ44-72-133 R01	NO. 1 ENGINE - REPLACE 1ST LP TURBINE NOZZLE, SERVICE BULLETIN			(EFF)		RECOMMENDED	
	05-FEB-2016	MOS	HRS/MSC DUE	ENC	4484 M		
SB FJ44-72-140	NO. 1 ENGINE - GEARBOX HOUSING ASSEMBLY - INSPECTION, SERVICE BULLETIN					MANDATORY	
	22-OCT-2015	MOS	HRS/MSC -	ENC	4484 M		
SB FJ44-72-150 R02	NO. 1 ENGINE - LP REAR BEARING SEAL RETAINER - REPLACE, SERVICE BULLETIN						
	29-OCT-2018	MOS	HRS/MSC -	ENC			
SB FJ44-72-154 R01	NO. 1 ENGINE - 1ST LP TURBINE NOZZLE - INSPECTION (CANCELLED), SERVICE BULLETIN					RECOMMENDED	
	08-MAR-2017	MOS	HRS/MSC -	ENC			
SB FJ44-73-043 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FADEC REPLACEMENT AND APPLICATION SOFTWARE UPLOAD, SERVICE BULLETIN					RECOMMENDED	
	12-JUL-2012	MOS	HRS/MSC -	ENC			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-044 R05	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R06), SERVICE BULLETIN					MANDATORY	COMPLIED WITH - COMPLIED WITH PER WILLIAMS INTERNATIONAL BY DAVID MCAULIFFE.
14-JUN-2016		MOS		18-JAN-2017			
		HRS/MSC -		2446:06			
		ENC		1784			
SB FJ44-73-044 R07	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					MANDATORY	
24-AUG-2017		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-73-044 R08	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					MANDATORY	
31-OCT-2019		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-77-011 R03	NO. 1 ENGINE - ENGINE INDICATING & FADEC ENGINE HARNESS ASSEMBLY & INSPECTION (SUPERSEDED BY FJ44-77-011 R04), SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH
27-OCT-2010		MOS		12-DEC-2010			
		HRS/MSC -		1129:30			
		ENC		869			
SB FJ44-77-011 R18	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION, SERVICE BULLETIN					MANDATORY	
14-NOV-2018		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-77-013 R07	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK, SERVICE BULLETIN					RECOMMENDED	
09-MAY-2016		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-77-013 R09	NO. 1 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK, SERVICE BULLETIN					RECOMMENDED	
17-JAN-2019		MOS		(EFF)			
		HRS/MSC -			4484 M		
		ENC					
SB FJ44-79-011 R04	NO. 1 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE, SERVICE BULLETIN					MANDATORY	
16-MAY-2014		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-011 R05	NO. 1 ENGINE - OIL - MAGNETIC SELF-CLOSING VALVE - REPLACE, SERVICE BULLETIN					MANDATORY	
08-OCT-2019		MOS		(EFF)			
		HRS/MSC MPI			4484 M		
		ENC					
SB FJ44-79-013 R02	NO. 1 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R03), SERVICE BULLETIN					RECOMMENDED	
25-AUG-2017		MOS					
		HRS/MSC -					
		ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-79-013 R03	NO. 1 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R04), SERVICE BULLETIN					RECOMMENDED	
26-MAR-2018		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-79-013 R04	NO. 1 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R05), SERVICE BULLETIN					RECOMMENDED	
21-MAY-2018		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-79-013 R05	NO. 1 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE, SERVICE BULLETIN					RECOMMENDED	
06-AUG-2018		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-79-015	NO. 1 ENGINE - CANCELLED - OIL - LUBE AND SCAVENGE PUMP ASSEMBLY - TIME EXTENSION OF TIME BETWEEN OVERHAUL (TBO) FOR TOTAL ASSURANCE PROGRAM (TAP), SERVICE BULLETIN					RECOMMENDED	
24-FEB-2015		MOS					
		HRS/MSC	-				
		ENC					
SB WISB-72-1004	NO. 1 ENGINE - 1ST LP TURBINE NOZZLE - REPLACE (SUPERSEDED BY WISB-72-1004 R01), SERVICE BULLETIN						
25-MAY-2017		MOS					
		HRS/MSC	-				
		ENC					
SB WISB-72-1034	NO. 1 ENGINE - HP TURBINE - RE-IDENTIFY ASSEMBLY AND DISK, SERVICE BULLETIN					MANDATORY	
20-DEC-2019		MOS					
		HRS/MSC	-				
		ENC					
SB WISB-72-1034 R01	NO. 1 ENGINE - HP TURBINE - RE-IDENTIFY ASSEMBLY AND DISK, SERVICE BULLETIN					MANDATORY	
10-JUN-2020		MOS		(EFF)			
		HRS/MSC	MPI				
		ENC					
SB WISB-72-1037 R01	NO. 1 ENGINE - ACCESSORY DRIVE TOWERSHAFT - REPLACE, SERVICE BULLETIN					RECOMMENDED	
18-JUN-2020		MOS		(EFF)			
		HRS/MSC	CSI				
		ENC					
SB WISB-72-1041	NO. 1 ENGINE - HEAT EXCHANGER CLAMP ASSEMBLY - REPLACE, SERVICE BULLETIN					RECOMMENDED	
19-JUN-2020		MOS		(EFF)			
		HRS/MSC	MPI				
		ENC					
SB WISB-73-1002	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE (SUPERSEDED BY WISB-73-1002 R01), SERVICE BULLETIN					MANDATORY	
20-DEC-2017		MOS					
		HRS/MSC	-				
		ENC					
SB WISB-73-1002 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE (CANCELLED), SERVICE BULLETIN					MANDATORY	
06-FEB-2018		MOS					
		HRS/MSC	-				
		ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB	WISB-73-1002 R02-CN	NO. 1 ENGINE - CANCELLED - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN				CANCELLED	
	06-FEB-2018	MOS					
		HRS/MSC -					
		ENC					
SB	WISB-73-1007 R01	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - ENGINE MAINTENANCE TERMINAL (EMT) SOFTWARE UPGRADE TO CP356.10.02 (CANCELLED), SERVICE BULLETIN					
	22-MAY-2018	MOS					
		HRS/MSC -					
		ENC					
SB	WISB-73-1008	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN				RECOMMENDED	
	13-JUL-2018	MOS					
		HRS/MSC -					
		ENC					
SB	WISB-73-1008 R01	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN				RECOMMENDED	
	27-JUL-2018	MOS					
		HRS/MSC -					
		ENC					
SB	WISB-73-1008 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN				RECOMMENDED	
	06-AUG-2018	MOS					
		HRS/MSC -					
		ENC					
SB	WISB-73-1008 R03	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN				RECOMMENDED	
	29-JAN-2019	MOS					
		HRS/MSC -					
		ENC					
SB	WISB-73-1008 R04	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN				RECOMMENDED	
	19-FEB-2019	MOS		(EFF)			
		HRS/MSC -					
		ENC					
SB	WISB-73-1009	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN				RECOMMENDED	
	13-JUL-2018	MOS					
		HRS/MSC -					
		ENC					
SB	WISB-73-1009 R02	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					
	06-AUG-2018	MOS					
		HRS/MSC -					
		ENC					
SB	WISB-73-1009 R03	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					
	30-JUL-2019	MOS					
		HRS/MSC -					
		ENC					
SB	WISB-73-1009 R04	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN				RECOMMENDED	
	05-AUG-2019	MOS		(EFF)			
		HRS/MSC CSI					
		ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-74-1000	NO. 1 ENGINE - IGNITION - IGNITER LEAD INSPECTION AND CLAMPING ARRANGEMENT, SERVICE BULLETIN					MANDATORY	
17-AUG-2017		MOS					
		HRS/MSC -					
		ENC					
SB WISB-75-1001 R01	NO. 1 ENGINE - AIR - I.P. BLEED VALVE LEVER PIN - REPLACE, SERVICE BULLETIN					RECOMMENDED	
25-JAN-2019		MOS		(EFF)			
		HRS/MSC -			4484 M		
		ENC					
SL SL44-72-310	NO. 1 ENGINE - ENGINE - HP TURBINE BLADES - REPLACE (SUPERSEDED BY SB FJ44-72-124 R07), SERVICE LETTER					COMPLIED WITH	
		MOS		01-AUG-2013			
		HRS/MSC -		1984			
		ENC		1477			
SL SL44-72-318	NO. 1 ENGINE - ENGINE - 1ST LP TURBINE NOZZLE - REPLACE, SERVICE LETTER					COMPLIED WITH	
		MOS		01-AUG-2013			
		HRS/MSC -		1984			
		ENC		1477			
SL SL44-73-061	NO. 1 ENGINE - ENGINE FUEL AND CONTROL – FUEL DELIVERY UNIT (FDU) – RUN 20 SNAP DECELS AT INSTALLATION, SERVICE LETTER					MANDATORY	
		MOS					
		HRS/MSC A/R					
		ENC					
SL WISL-05-1007	NO. 1 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE CHECKS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						
04-JUN-2019		MOS					
		HRS/MSC -					
		ENC					
SL WISL-05-1007-CN	NO. 1 ENGINE - CANCELED - TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE CHECKS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					CANCELLED	
16-OCT-2019		MOS					
		HRS/MSC -					
		ENC					
SL WISL-05-1020	NO. 1 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE CHECKS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						
06-MAR-2020		MOS					
		HRS/MSC -					
		ENC					
SL WISL-05-1022	NO. 1 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - UNSERVICEABLE PARTS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						
07-APR-2020		MOS					
		HRS/MSC -					
		ENC					
SL WISL-71-1064	NO. 1 ENGINE - POWER PLANT - WATER RINSE PROCEDURE - REVISION TO MAINTENANCE MANUAL, SERVICE LETTER						
04-OCT-2018		MOS					
		HRS/MSC -					
		ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL	WISL-71-1064-CN	NO. 1 ENGINE - CANCELED - POWER PLANT - WATER RINSE PROCEDURE - REVISION TO MAINTENANCE MANUAL, SERVICE LETTER				CANCELLED	
	15-JAN-2019	MOS	HRS/MSC -	ENC			
SL	WISL-71-1129	NO. 1 ENGINE - CANCELED - POWER PLANT - BIT NO. 50 FAULT TROUBLESHOOTING - REVISION TO MAINTENANCE MANUAL, SERVICE LETTER				CANCELLED	
	23-JAN-2020	MOS	HRS/MSC -	ENC			
SL	WISL-72-1032-CN	NO. 1 ENGINE - APPROVED ENGINE FUELS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER				CANCELLED	
	23-JUL-2020	MOS	HRS/MSC -	ENC			
SL	WISL-72-1128	NO. 1 ENGINE - FAN ROTOR - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					
	23-MAR-2020	MOS	HRS/MSC -	ENC			
SL	WISL-72-1132	NO. 1 ENGINE - APPROVED ENGINE FUELS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					
	06-APR-2020	MOS	HRS/MSC -	ENC			
SL	WISL-72-1132-CN	NO. 1 ENGINE - CANCELED - ENGINE - APPROVED ENGINE FUELS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER				CANCELLED	
	22-JUL-2020	MOS	HRS/MSC -	ENC			
SL	WISL-72-1140	NO. 1 ENGINE - INDUCTION HEATING - REVISION TO ENGINE MANUAL, SERVICE LETTER					
	22-JUN-2020	MOS	HRS/MSC -	ENC			
SL	WISL-73-1018	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - REVISION TO ILLUSTRATED PARTS CATALOG, SERVICE LETTER					
	04-JUN-2019	MOS	HRS/MSC -	ENC			
SL	WISL-73-1018-CN	NO. 1 ENGINE - CANCELED - ENGINE FUEL AND CONTROL - REVISION TO ILLUSTRATED PARTS CATALOG, SERVICE LETTER				CANCELLED	
	16-OCT-2019	MOS	HRS/MSC -	ENC			
SL	WISL-73-1026	NO. 1 ENGINE - ENGINE CONTROLS - EMT COMMUNICATION TOOLING - REVISION TO THE LINE MAINTENANCE MANUAL, SERVICE LETTER					
	27-SEP-2019	MOS	HRS/MSC -	ENC			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL WISL-73-1037	NO. 1 ENGINE - ENGINE FUEL AND CONTROL - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						
		MOS					
	18-SEP-2020	HRS/MSC -					
		ENC					
SL WISL-76-1001	NO. 1 ENGINE - ENGINE CONTROLS - VISUALLY INSPECT THE LP SHAFT TRIP SENSOR SYSTEM - REVISION TO THE LINE MAINTENANCE MANUAL, SERVICE LETTER						
		MOS					
	02-OCT-2019	HRS/MSC -					
		ENC					
SL WISL-76-1001-CN	NO. 1 ENGINE - CANCELED - ENGINE CONTROLS - VISUALLY INSPECT THE LP SHAFT TRIP SENSOR SYSTEM - REVISION TO THE LINE MAINTENANCE MANUAL, SERVICE LETTER					CANCELLED	
		MOS					
	21-JAN-2020	HRS/MSC -					
		ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC	
ENGINE NO. 2 - SB - 216118/75000-200								
SB	FJ44-05-002	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION (SUPERSEDED BY FJ44-05-002 R01), SERVICE BULLETIN					INFORMATIONAL	
	02-OCT-2015	MOS	HRS/MSC -	ENC				
SB	FJ44-05-002 R01	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION (SUPERSEDED BY FJ44-05-002 R02), SERVICE BULLETIN					INFORMATIONAL	
	22-MAY-2017	MOS	HRS/MSC -	ENC				
SB	FJ44-05-002 R03	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN					INFORMATIONAL	
	12-MAR-2019	MOS	HRS/MSC -	ENC				
SB	FJ44-05-002 R04	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN					INFORMATIONAL	
	01-OCT-2019	MOS	HRS/MSC -	ENC				
SB	FJ44-05-002 R05	NO. 2 ENGINE - UNSERVICEABLE PARTS - NOTIFICATION, SERVICE BULLETIN					INFORMATIONAL	
	24-MAR-2020	MOS	HRS/MSC -	ENC				
SB	FJ44-05-002 R05-CN	NO. 2 ENGINE - SUPERSEDED - UNSERVICEABLE PARTS - NOTIFICATION (THIS SERVICE DOCUMENT HAS BEEN SUPERSEDED BY WIPSID-05-1000), SERVICE BULLETIN					CANCELLED	
	07-APR-2020	MOS	HRS/MSC -	ENC				
SB	FJ44-72-066 R02	NO. 2 ENGINE - ENGINE - HOUSING, CARBON RING SEAL AND BEARING (NO. 3 BEARING RETAINER) - REPLACE (SUPERSEDED BY FJ44-72-066 R03), SERVICE BULLETIN					SUPERSEDED	
	16-DEC-2010	MOS	HRS/MSC -	ENC				
SB	FJ44-72-066 R03	NO. 2 ENGINE - ENGINE - CARBON RING SEAL AND BEARING HOUSING - REPLACE (SUPERSEDED BY FJ44-72-066 R04), SERVICE BULLETIN					RECOMMENDED	
	03-JUN-2011	MOS	HRS/MSC -	ENC				
SB	FJ44-72-066 R06	NO. 2 ENGINE - CARBON RING SEAL AND BEARING HOUSING - REPLACE, SERVICE BULLETIN					RECOMMENDED	
	09-DEC-2015	MOS	HRS/MSC -	ENC				
SB	FJ44-72-068 R03	NO. 2 ENGINE - ENGINE - UPGRADE GEARBOX (4K MAGSEAL) TO SPRING LOADED CONFIGURATION (SUPERSEDED BY FJ44-72-068 R04), SERVICE BULLETIN					OPTIONAL	
	05-OCT-2010	MOS	HRS/MSC -	ENC				

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-070 R02	NO. 2 ENGINE - CANCELLED - UPGRADE GEARBOX (4K SPRING-LOADED) TO IMPROVED CONFIGURATION (SUPERSEDED BY SB FJ44-72-105 R01), SERVICE BULLETIN					CANCELLED	
18-DEC-2009		MOS		HRS/MSC -			
				ENC			
SB FJ44-72-075 R01	NO. 2 ENGINE - GEARBOX P/N 78823 - INSPECTION, SERVICE BULLETIN					MANDATORY	
17-AUG-2009		MOS		HRS/MSC A/R			
				ENC			
SB FJ44-72-078 R01	NO. 2 ENGINE - ENGINE - IP COMPRESSOR STATOR (STAGE 1-2) - REWORK (SUPERSEDED BY FJ44-72-078 R02), SERVICE BULLETIN					OPTIONAL	
15-APR-2013		MOS		HRS/MSC -			
				ENC			
SB FJ44-72-078 R02	NO. 2 ENGINE - IP COMPRESSOR STATOR (STAGE 1-2) - REWORK (SUPERSEDED BY FJ44-72-078 R03), SERVICE BULLETIN					OPTIONAL	
12-FEB-2015		MOS		HRS/MSC -			
				ENC			
SB FJ44-72-078 R03	NO. 2 ENGINE - IP COMPRESSOR STATOR (STAGE 1-2) - REWORK, SERVICE BULLETIN					OPTIONAL	
26-FEB-2016		MOS		HRS/MSC -			
				ENC			
SB FJ44-72-085 R05	NO. 2 ENGINE - ENGINE - IP BLEED VALVE - REPLACE (SUPERSEDED BY FJ44-72-085 R06), SERVICE BULLETIN					RECOMMENDED	
20-MAY-2011		MOS		HRS/MSC -			
				ENC			
SB FJ44-72-086 R02	NO. 2 ENGINE - ENGINE - BLEED VALVE SHAFT - REPLACE (SUPERSEDED BY FJ44-72-086 R03), SERVICE BULLETIN					RECOMMENDED	
16-JUL-2010		MOS		HRS/MSC -			
				ENC			
SB FJ44-72-086 R03	NO. 2 ENGINE - ENGINE - BLEED VALVE SHAFT - REPLACE, SERVICE BULLETIN					RECOMMENDED	
05-OCT-2010		MOS		HRS/MSC -			
				ENC			
SB FJ44-72-093	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R01), SERVICE BULLETIN					MANDATORY	
07-MAY-2010		MOS		HRS/MSC -			
				ENC			
SB FJ44-72-093 R02	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R03), SERVICE BULLETIN					MANDATORY	
25-AUG-2010		MOS		HRS/MSC -			
				ENC			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-093 R03	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R04), SERVICE BULLETIN					MANDATORY	
17-NOV-2010		MOS	HRS/MSC -	ENC			
SB FJ44-72-093 R05	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R06), SERVICE BULLETIN					MANDATORY	
08-MAR-2011		MOS	HRS/MSC -	ENC			
SB FJ44-72-093 R06	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R07), SERVICE BULLETIN					MANDATORY	
25-MAY-2011		MOS	HRS/MSC -	ENC			
SB FJ44-72-093 R07	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R08), SERVICE BULLETIN					MANDATORY	
28-JUN-2011		MOS	HRS/MSC -	ENC			
SB FJ44-72-093 R08	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R09), SERVICE BULLETIN					MANDATORY	
07-OCT-2011		MOS	HRS/MSC -	ENC			
SB FJ44-72-093 R09	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY (SUPERSEDED BY FJ44-72-093 R10), SERVICE BULLETIN					MANDATORY	
29-NOV-2011		MOS	HRS/MSC -	ENC			
SB FJ44-72-093 R10	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R11), SERVICE BULLETIN					MANDATORY	
13-APR-2012		MOS	HRS/MSC -	ENC			
SB FJ44-72-093 R11	NO. 2 ENGINE - ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-72-093 R12), SERVICE BULLETIN					MANDATORY	
01-AUG-2012		MOS	HRS/MSC -	ENC			
SB FJ44-72-093 R12	NO. 2 ENGINE - DIFFUSER CASE ASSEMBLY - REPLACE, SERVICE BULLETIN					MANDATORY	
01-APR-2014		MOS	HRS/MSC -	ENC			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-097	NO. 2 ENGINE - ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-097 R01), SERVICE BULLETIN	MOS HRS/MSC - ENC				MANDATORY	
SB FJ44-72-105 R02	NO. 2 ENGINE - UPGRADE GEARBOX (4K SPRING LOADED) TO IMPROVED CONFIGURATION (SUPERSEDED BY FJ44-72-105 R03), SERVICE BULLETIN	MOS HRS/MSC - ENC			24-MAR-2015	OPTIONAL	
SB FJ44-72-105 R03	NO. 2 ENGINE - UPGRADE GEARBOX (4K SPRING LOADED) TO IMPROVED CONFIGURATION (SUPERSEDED BY FJ44-72-105 R04), SERVICE BULLETIN	MOS HRS/MSC - ENC			22-JAN-2016	OPTIONAL	
SB FJ44-72-105 R04	NO. 2 ENGINE - UPGRADE GEARBOX (4K SPRING LOADED) TO IMPROVED CONFIGURATION, SERVICE BULLETIN	MOS HRS/MSC - ENC			14-NOV-2016	OPTIONAL	
SB FJ44-72-106 R01	NO. 2 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN	MOS HRS/MSC - ENC			24-MAR-2015	RECOMMENDED	
SB FJ44-72-107	NO. 2 ENGINE - ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE (SUPERSEDED BY FJ44-72-107 R01), SERVICE BULLETIN	MOS HRS/MSC - ENC			20-MAR-2013	RECOMMENDED	
SB FJ44-72-107 R01	NO. 2 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE (SUPERSEDED BY FJ44-72-107 R02), SERVICE BULLETIN	MOS HRS/MSC - ENC			07-NOV-2013	RECOMMENDED	
SB FJ44-72-107 R02	NO. 2 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN	MOS HRS/MSC DUE ENC			24-MAR-2015	RECOMMENDED	
SB FJ44-72-107 R03	NO. 2 ENGINE - 2ND REDUCTION PINION BEARING HOUSING - REPLACE, SERVICE BULLETIN	MOS HRS/MSC CSI ENC		(EFF)	11-OCT-2019	RECOMMENDED	3880:30 M
SB FJ44-72-108	NO. 2 ENGINE - ACCESSORY DRIVE SHAFT - REPLACE (SUPERSEDED BY FJ44-72-108 R01), SERVICE BULLETIN	MOS HRS/MSC - ENC			17-APR-2013	RECOMMENDED	

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-108 R01	NO. 2 ENGINE - ACCESSORY DRIVE SHAFT - REPLACE (SUPERSEDED BY SB WISB-72-1037 R01), SERVICE BULLETIN					RECOMMENDED	
17-JUN-2014		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-108 R01-CN	NO. 2 ENGINE - SUPERSEDED - ACCESSORY DRIVE SHAFT - REPLACE (THIS SERVICE DOCUMENT IS NO LONGER AVAILABLE), SERVICE BULLETIN					CANCELLED	
18-JUN-2020		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-109	NO. 2 ENGINE - ENGINE - 1ST REDUCTION BEVEL GEAR BALL BEARING - REPLACE, SERVICE BULLETIN					RECOMMENDED	
17-APR-2013		MOS					
		HRS/MSC	-		3880:30 M		
		ENC					
SB FJ44-72-110	NO. 2 ENGINE - ENGINE - DAMPENER BRACKET ASSEMBLY - REPLACE, SERVICE BULLETIN					MANDATORY	
17-APR-2013		MOS					
		HRS/MSC	DUE		3880:30 M		
		ENC					
SB FJ44-72-122-CN	NO. 2 ENGINE - SUPERSEDED - ENGINE - ACCESSORY DRIVE SHAFT - REPLACE, SERVICE BULLETIN					CANCELLED	
06-DEC-2019		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-123 R01	NO. 2 ENGINE - CANCELLED - INNER GUIDED ROLLER BEARING (NO. 3 BEARING) - REPLACE, SERVICE BULLETIN					CANCELLED	
31-MAR-2015		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-124	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE (SUPERSEDED BY FJ44-72-124 R01), SERVICE BULLETIN					RECOMMENDED	
09-DEC-2014		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-124 R01	NO. 2 ENGINE - REPLACE HP TURBINE BLADES (SUPERSEDED BY FJ44-72-124 R02), SERVICE BULLETIN					RECOMMENDED	
27-JAN-2015		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-124 R03	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
06-FEB-2018		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-124 R04	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
04-MAY-2018		MOS					
		HRS/MSC	-				
		ENC					
SB FJ44-72-124 R06	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
27-MAY-2020		MOS					
		HRS/MSC	-				
		ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-124 R07	NO. 2 ENGINE - HP TURBINE BLADES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
	10-DEC-2020	MOS		HRS/MSC -			
				ENC			
SB FJ44-72-128	NO. 2 ENGINE - SPLIT INNER RING BALL BEARING - REPLACE (SUPERSEDED BY FJ44-72-128 R01), SERVICE BULLETIN					MANDATORY	
	19-JAN-2015	MOS		HRS/MSC -			
				ENC			
SB FJ44-72-129	NO. 2 ENGINE - REPLACE INNER GUIDED ROLLER BEARING (NO. 3 BEARING), SERVICE BULLETIN					MANDATORY	
	06-FEB-2015	MOS		HRS/MSC -			
				ENC			
SB FJ44-72-129 R01	NO. 2 ENGINE - INNER GUIDED ROLLER BEARING (NO. 3 BEARING) - REPLACE, SERVICE BULLETIN					MANDATORY	
	22-JAN-2019	MOS		(EFF)			
				HRS/MSC MPI	3880 M		
				ENC			
SB FJ44-72-130	NO. 2 ENGINE - HP COMPRESSOR ROTOR - INSPECTION (SUPERSEDED BY FJ44-72-130 R01), SERVICE BULLETIN					RECOMMENDED	
	05-MAR-2015	MOS		HRS/MSC -			
				ENC			
SB FJ44-72-130 R01	NO. 2 ENGINE - HP COMPRESSOR ROTOR - INSPECTION (SUPERSEDED BY FJ44-72-130 R02), SERVICE BULLETIN					RECOMMENDED	
	08-MAY-2017	MOS		HRS/MSC -			
				ENC			
SB FJ44-72-130 R02	NO. 2 ENGINE - HP COMPRESSOR ROTOR - INSPECTION, SERVICE BULLETIN					RECOMMENDED	
	06-FEB-2018	MOS		HRS/MSC -			
				ENC			
SB FJ44-72-133	NO. 2 ENGINE - REPLACE 1ST LP TURBINE NOZZLE (SUPERSEDED BY FJ44-72-133 R01), SERVICE BULLETIN					RECOMMENDED	
	27-JAN-2016	MOS		HRS/MSC -			
				ENC			
SB FJ44-72-133 R01	NO. 2 ENGINE - REPLACE 1ST LP TURBINE NOZZLE, SERVICE BULLETIN					RECOMMENDED	
	05-FEB-2016	MOS		(EFF)			
				HRS/MSC DUE	3880:30 M		
				ENC			
SB FJ44-72-135 R01	NO. 2 ENGINE - IDENTIFICATION PLATE - REPLACE, SERVICE BULLETIN					MANDATORY	
	02-JUL-2015	MOS		(EFF)			
				HRS/MSC DUE			
				ENC			
SB FJ44-72-140	NO. 2 ENGINE - GEARBOX HOUSING ASSEMBLY - INSPECTION, SERVICE BULLETIN					MANDATORY	
	22-OCT-2015	MOS		HRS/MSC DUE	3880:30 M		
				ENC			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-72-150 R02	NO. 2 ENGINE - LP REAR BEARING SEAL RETAINER - REPLACE, SERVICE BULLETIN						
29-OCT-2018		MOS	HRS/MSC -	ENC			
SB FJ44-72-151 R01	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL (SUPERSEDED BY FJ44-72-151 R02), SERVICE BULLETIN					MANDATORY	
25-JAN-2017		MOS	HRS/MSC -	ENC			
SB FJ44-72-151 R02	NO. 2 ENGINE - BEARING AND PINION ASSEMBLY - INSTALL (SUPERSEDED BY FJ44-72-151 R03), SERVICE BULLETIN					MANDATORY	
10-FEB-2017		MOS	HRS/MSC -	ENC			
SB FJ44-72-154	NO. 2 ENGINE - 1ST LP TURBINE NOZZLE - INSPECTION (SUPERSEDED BY FJ44-72-154 R01), SERVICE BULLETIN					RECOMMENDED	
15-FEB-2017		MOS	HRS/MSC -	ENC			
SB FJ44-72-154 R01	NO. 2 ENGINE - 1ST LP TURBINE NOZZLE - INSPECTION (CANCELLED), SERVICE BULLETIN					RECOMMENDED	
08-MAR-2017		MOS	HRS/MSC -	ENC			
SB FJ44-73-030 R07	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FADEC SOFTWARE UPLOAD OF CP219.11.06 (SUPERSEDED BY FJ44-73-030 R08), SERVICE BULLETIN					MANDATORY	
21-MAY-2010		MOS	HRS/MSC A/R	ENC			
SB FJ44-73-038 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R02), SERVICE BULLETIN					MANDATORY	
31-MAR-2011		MOS	HRS/MSC A/R	ENC			
SB FJ44-73-038 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-038 R03), SERVICE BULLETIN					MANDATORY	
18-APR-2011		MOS	HRS/MSC A/R	ENC			
SB FJ44-73-039 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-039 R02), SERVICE BULLETIN					MANDATORY	
31-MAR-2011		MOS	HRS/MSC A/R	ENC			
SB FJ44-73-039 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - DUAL CHANNEL FADEC - REPLACE (SUPERSEDED BY FJ44-73-039 R03), SERVICE BULLETIN					MANDATORY	
18-APR-2011		MOS	HRS/MSC A/R	ENC			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-73-039 R06	NO. 2 ENGINE - DUAL CHANNEL FADEC - REPLACE, SERVICE BULLETIN					MANDATORY	
	22-OCT-2014	MOS	HRS/MSC -	ENC			
SB FJ44-73-042 R01	NO. 2 ENGINE - REPLACE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET (SUPERSEDED BY FJ44-73-042 R02), SERVICE BULLETIN					RECOMMENDED	
	23-MAR-2011	MOS	HRS/MSC -	ENC			
SB FJ44-73-042 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE LOOP CLAMP BRACKET - REPLACE (SUPERSEDED BY FJ44-73-042 R03), SERVICE BULLETIN					RECOMMENDED	
	24-AUG-2011	MOS	HRS/MSC -	ENC			
SB FJ44-73-043 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FADEC REPLACEMENT AND APPLICATION SOFTWARE UPLOAD, SERVICE BULLETIN					RECOMMENDED	
	12-JUL-2012	MOS	HRS/MSC -	ENC			
SB FJ44-73-044 R05	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R06), SERVICE BULLETIN					MANDATORY	
	14-JUN-2016	MOS	HRS/MSC -	ENC			
SB FJ44-73-044 R06	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-044 R07), SERVICE BULLETIN					MANDATORY	
	16-MAR-2017	MOS	HRS/MSC -	ENC			
SB FJ44-73-044 R08	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE, SERVICE BULLETIN					MANDATORY	
	31-OCT-2019	MOS	HRS/MSC -	ENC			
SB FJ44-73-046 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL DELIVERY UNIT - REPLACE (SUPERSEDED BY FJ44-73-046 R03), SERVICE BULLETIN					MANDATORY	
	16-MAR-2017	MOS	HRS/MSC -	ENC			
SB FJ44-73-061	NO. 2 ENGINE - CANCELLED - FUEL DELIVERY UNIT (FDU) - TIME EXTENSION OF TIME BETWEEN OVERHAUL (TBO), SERVICE BULLETIN					RECOMMENDED	
	09-JAN-2015	MOS	HRS/MSC -	ENC			
SB FJ44-77-009 R01	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY SB FJ44-77-011 R18), SERVICE BULLETIN					RECOMMENDED	
		MOS	HRS/MSC -	ENC			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-77-011 R17	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION (SUPERSEDED BY FJ44-77-011 R18), SERVICE BULLETIN					MANDATORY	
09-MAY-2016		MOS	HRS/MSC -	ENC			
SB FJ44-77-011 R18	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - INSPECTION, SERVICE BULLETIN					MANDATORY	
14-NOV-2018		MOS	HRS/MSC -	ENC			
SB FJ44-77-013	NO. 2 ENGINE - FADEC ENGINE HARNESS ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-77-013 R01), SERVICE BULLETIN					RECOMMENDED	
20-JAN-2015		MOS	HRS/MSC -	ENC			
SB FJ44-77-013 R01	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R02), SERVICE BULLETIN					RECOMMENDED	
18-MAR-2015		MOS	HRS/MSC -	ENC			
SB FJ44-77-013 R02	NO. 2 ENGINE - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R03), SERVICE BULLETIN					RECOMMENDED	
16-JUN-2015		MOS	HRS/MSC -	ENC	(EFF)		
SB FJ44-77-013 R03	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R04), SERVICE BULLETIN					RECOMMENDED	
17-JUL-2015		MOS	HRS/MSC -	ENC			
SB FJ44-77-013 R04	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R05), SERVICE BULLETIN					RECOMMENDED	
01-SEP-2015		MOS	HRS/MSC -	ENC			
SB FJ44-77-013 R05	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R06), SERVICE BULLETIN					RECOMMENDED	
22-OCT-2015		MOS	HRS/MSC -	ENC			
SB FJ44-77-013 R06	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK (SUPERSEDED BY FJ44-77-013 R07), SERVICE BULLETIN					RECOMMENDED	
02-FEB-2016		MOS	HRS/MSC -	ENC			
SB FJ44-77-013 R07	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK, SERVICE BULLETIN					RECOMMENDED	
09-MAY-2016		MOS	HRS/MSC -	ENC			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-77-013 R09	NO. 2 ENGINE - ENGINE INDICATING - FADEC ENGINE HARNESS ASSEMBLY - REWORK, SERVICE BULLETIN			(EFF)		RECOMMENDED	
17-JAN-2019		MOS			3880:30 M		
		HRS/MSC -					
		ENC					
SB FJ44-79-009 R02	NO. 2 ENGINE - ADJUST-LUBRICATION-OIL PRESSURE VALVE (SUPERSEDED BY FJ44-79-009 R03), SERVICE BULLETIN					RECOMMENDED	
26-JUL-2011		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-009 R05	NO. 2 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST (SUPERSEDED BY FJ44-79-009 R06), SERVICE BULLETIN					RECOMMENDED	
30-APR-2013		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-009 R08	NO. 2 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST, SERVICE BULLETIN					RECOMMENDED	
29-JUN-2016		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-011	NO. 2 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE (SUPERSEDED BY FJ44-79-011 R01), SERVICE BULLETIN					MANDATORY	
17-JAN-2013		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-011 R01	NO. 2 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE (SUPERSEDED BY FJ44-79-011 R02), SERVICE BULLETIN					MANDATORY	
13-MAR-2013		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-011 R03	NO. 2 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE (SUPERSEDED BY FJ44-79-011 R04), SERVICE BULLETIN					MANDATORY	
23-JUL-2013		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-011 R04	NO. 2 ENGINE - MAGNETIC SELF-CLOSING VALVE - REPLACE, SERVICE BULLETIN					MANDATORY	
16-MAY-2014		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-011 R05	NO. 2 ENGINE - OIL - MAGNETIC SELF-CLOSING VALVE - REPLACE, SERVICE BULLETIN			(EFF)		MANDATORY	
08-OCT-2019		MOS			3880:30 M		
		HRS/MSC MPI					
		ENC					
SB FJ44-79-013	NO. 2 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R01), SERVICE BULLETIN					OPTIONAL	
18-OCT-2016		MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-013 R01	NO. 2 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R02), SERVICE BULLETIN					OPTIONAL	
08-DEC-2016		MOS					
		HRS/MSC -					
		ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB FJ44-79-013 R03	NO. 2 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R04), SERVICE BULLETIN					RECOMMENDED	
	26-MAR-2018	MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-013 R04	NO. 2 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-013 R05), SERVICE BULLETIN					RECOMMENDED	
	21-MAY-2018	MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-013 R05	NO. 2 ENGINE - OIL - OIL FILLER CAP ASSEMBLY - REPLACE, SERVICE BULLETIN					RECOMMENDED	
	06-AUG-2018	MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-015	NO. 2 ENGINE - CANCELLED - OIL - LUBE AND SCAVENGE PUMP ASSEMBLY - TIME EXTENSION OF TIME BETWEEN OVERHAUL (TBO) FOR TOTAL ASSURANCE PROGRAM (TAP), SERVICE BULLETIN					RECOMMENDED	
	24-FEB-2015	MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-016 R01	NO. 2 ENGINE - OIL - RELIEF VALVE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-016 R02), SERVICE BULLETIN					RECOMMENDED	
	30-NOV-2016	MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-016 R02	NO. 2 ENGINE - OIL - RELIEF VALVE ASSEMBLY - REPLACE (SUPERSEDED BY FJ44-79-016 R03), SERVICE BULLETIN					RECOMMENDED	
	15-FEB-2017	MOS					
		HRS/MSC -					
		ENC					
SB FJ44-79-T017 R01	NO. 2 ENGINE - LUBRICATION - OIL PRESSURE RELIEF VALVE - ADJUST, SERVICE BULLETIN					RECOMMENDED	
	04-NOV-2008	MOS					
		HRS/MSC -					
		ENC					
SB WISB-72-1004	NO. 2 ENGINE - 1ST LP TURBINE NOZZLE - REPLACE (SUPERSEDED BY WISB-72-1004 R01), SERVICE BULLETIN						
	25-MAY-2017	MOS					
		HRS/MSC -					
		ENC					
SB WISB-72-1034	NO. 2 ENGINE - HP TURBINE - RE-IDENTIFY ASSEMBLY AND DISK, SERVICE BULLETIN					MANDATORY	
	20-DEC-2019	MOS					
		HRS/MSC -					
		ENC					
SB WISB-72-1034 R01	NO. 2 ENGINE - HP TURBINE - RE-IDENTIFY ASSEMBLY AND DISK, SERVICE BULLETIN					MANDATORY	
	10-JUN-2020	MOS		(EFF)			
		HRS/MSC MPI					
		ENC					
SB WISB-72-1037 R01	NO. 2 ENGINE - ACCESSORY DRIVE TOWERSHAFT - REPLACE, SERVICE BULLETIN					RECOMMENDED	
	18-JUN-2020	MOS		(EFF)			
		HRS/MSC CSI					
		ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-72-1041	NO. 2 ENGINE - HEAT EXCHANGER CLAMP ASSEMBLY - REPLACE, SERVICE BULLETIN			(EFF)		RECOMMENDED	
19-JUN-2020		MOS HRS/MSC ENC	MPI				
SB WISB-73-1002	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE (SUPERSEDED BY WISB-73-1002 R01), SERVICE BULLETIN					MANDATORY	
20-DEC-2017		MOS HRS/MSC ENC	-				
SB WISB-73-1002 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE (CANCELLED), SERVICE BULLETIN					MANDATORY	
06-FEB-2018		MOS HRS/MSC ENC	-				
SB WISB-73-1002 R02-CN	NO. 2 ENGINE - CANCELLED - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					CANCELLED	
06-FEB-2018		MOS HRS/MSC ENC	-				
SB WISB-73-1007 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - ENGINE MAINTENANCE TERMINAL (EMT) SOFTWARE UPGRADE TO CP356.10.02 (CANCELLED), SERVICE BULLETIN						
22-MAY-2018		MOS HRS/MSC ENC	-				
SB WISB-73-1008	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					RECOMMENDED	
13-JUL-2018		MOS HRS/MSC ENC	-				
SB WISB-73-1008 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					RECOMMENDED	
27-JUL-2018		MOS HRS/MSC ENC	-				
SB WISB-73-1008 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					RECOMMENDED	COMPLIED WITH - COMPLIED WITH SB BY WILLIAMS INTERNATIONAL WHILE ENGINE WAS BEING REPAIRED.
06-AUG-2018		MOS HRS/MSC ENC	-	05-JAN-2019			
SB WISB-73-1008 R03	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					RECOMMENDED	
29-JAN-2019		MOS HRS/MSC ENC	-				
SB WISB-73-1008 R04	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - OIL COOLER TO FDU FUEL TUBE - REPLACE, SERVICE BULLETIN					RECOMMENDED	
19-FEB-2019		MOS HRS/MSC ENC	-				

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SB WISB-73-1009	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN					RECOMMENDED	
13-JUL-2018		MOS HRS/MSC - ENC					
SB WISB-73-1009 R01	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN						
27-JUL-2018		MOS HRS/MSC - ENC					
SB WISB-73-1009 R02	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN						COMPLIED WITH - COMPLIED WITH SB BY WILLIAMS INTERNATIONAL WHILE BEING REPAIRED.
06-AUG-2018		MOS HRS/MSC - ENC		05-JAN-2019			
SB WISB-73-1009 R03	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN						
30-JUL-2019		MOS HRS/MSC - ENC					
SB WISB-73-1009 R04	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - FUEL TUBE ASSEMBLIES - REPLACE, SERVICE BULLETIN						
05-AUG-2019		MOS HRS/MSC - ENC					
SB WISB-75-1001 R01	NO. 2 ENGINE - AIR - I.P. BLEED VALVE LEVER PIN - REPLACE, SERVICE BULLETIN					RECOMMENDED	
25-JAN-2019		MOS HRS/MSC - ENC		(EFF)	3880:30 M		
SL SL44-71-385	NO. 2 ENGINE - START ITT EXCEEDANCE - BORESCOPE INSPECTION & HIGH POWER CHECK RUN, SERVICE LETTER						
06-JAN-2017		MOS HRS/MSC - ENC					
SL WISL-05-1007	NO. 2 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE CHECKS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						
04-JUN-2019		MOS HRS/MSC - ENC					
SL WISL-05-1007-CN	NO. 2 ENGINE - CANCELED - TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE CHECKS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					CANCELLED	
16-OCT-2019		MOS HRS/MSC - ENC					
SL WISL-05-1020	NO. 2 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - SCHEDULED MAINTENANCE CHECKS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						
06-MAR-2020		MOS HRS/MSC - ENC					

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL WISL-05-1022	NO. 2 ENGINE - TIME LIMITS/MAINTENANCE CHECKS - UNSERVICEABLE PARTS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						
07-APR-2020		MOS	HRS/MSC -	ENC			
SL WISL-71-1064	NO. 2 ENGINE - POWER PLANT - WATER RINSE PROCEDURE - REVISION TO MAINTENANCE MANUAL, SERVICE LETTER						
04-OCT-2018		MOS	HRS/MSC -	ENC			
SL WISL-71-1064-CN	NO. 2 ENGINE - CANCELED - POWER PLANT - WATER RINSE PROCEDURE - REVISION TO MAINTENANCE MANUAL, SERVICE LETTER					CANCELLED	
15-JAN-2019		MOS	HRS/MSC -	ENC			
SL WISL-71-1129	NO. 2 ENGINE - CANCELED - POWER PLANT - BIT NO. 50 FAULT TROUBLESHOOTING -REVISION TO MAINTENANCE MANUAL, SERVICE LETTER					CANCELLED	
23-JAN-2020		MOS	HRS/MSC -	ENC			
SL WISL-72-1032-CN	NO. 2 ENGINE - APPROVED ENGINE FUELS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					CANCELLED	
23-JUL-2020		MOS	HRS/MSC -	ENC			
SL WISL-72-1128	NO. 2 ENGINE - FAN ROTOR - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						
23-MAR-2020		MOS	HRS/MSC -	ENC			
SL WISL-72-1132	NO. 2 ENGINE - APPROVED ENGINE FUELS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						
06-APR-2020		MOS	HRS/MSC -	ENC			
SL WISL-72-1132-CN	NO. 2 ENGINE - CANCELED - ENGINE - APPROVED ENGINE FUELS - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER					CANCELLED	
22-JUL-2020		MOS	HRS/MSC -	ENC			
SL WISL-72-1140	NO. 2 ENGINE - INDUCTION HEATING - REVISION TO ENGINE MANUAL, SERVICE LETTER						
22-JUN-2020		MOS	HRS/MSC -	ENC			
SL WISL-73-1018	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - REVISION TO ILLUSTRATED PARTS CATALOG, SERVICE LETTER						
04-JUN-2019		MOS	HRS/MSC -	ENC			

Task No.	Description	Unit	Interval	Compliance	Next Due	Disposition	MOC
SL WISL-73-1018-CN	NO. 2 ENGINE - CANCELED - ENGINE FUEL AND CONTROL - REVISION TO ILLUSTRATED PARTS CATALOG, SERVICE LETTER					CANCELLED	
16-OCT-2019		MOS	HRS/MSC -	ENC			
SL WISL-73-1026	NO. 2 ENGINE - ENGINE CONTROLS - EMT COMMUNICATION TOOLING - REVISION TO THE LINE MAINTENANCE MANUAL, SERVICE LETTER						
27-SEP-2019		MOS	HRS/MSC -	ENC			
SL WISL-73-1037	NO. 2 ENGINE - ENGINE FUEL AND CONTROL - REVISION TO LINE MAINTENANCE MANUAL, SERVICE LETTER						
18-SEP-2020		MOS	HRS/MSC -	ENC			
SL WISL-76-1001	NO. 2 ENGINE - ENGINE CONTROLS - VISUALLY INSPECT THE LP SHAFT TRIP SENSOR SYSTEM - REVISION TO THE LINE MAINTENANCE MANUAL, SERVICE LETTER						
02-OCT-2019		MOS	HRS/MSC -	ENC			
SL WISL-76-1001-CN	NO. 2 ENGINE - CANCELED - ENGINE CONTROLS - VISUALLY INSPECT THE LP SHAFT TRIP SENSOR SYSTEM - REVISION TO THE LINE MAINTENANCE MANUAL, SERVICE LETTER					CANCELLED	
21-JAN-2020		MOS	HRS/MSC -	ENC			